

MEMORANDUM

To: Mark Giordano
Giordano Industrial

From: John Canning, P.E.
Thomas Zhao, E.I.T.
Kimley-Horn Engineering and Landscape Architecture of New York, P.C.

Date: July 15, 2026, **Updated August 12, 2026**

Subject: Proposed Residential Development
3222 Albany Post Road, Village of Buchanan, NY
Traffic Impact Memorandum

Kimley-Horn Engineering and Landscape Architecture of New York, P.C. (“Kimley-Horn”) has completed the evaluation of the proposed residential development located at 3222 Albany Post Road in the Village of Buchanan, New York (the “Project”). The Project’s anticipated trip generation was determined, the sight distances at the proposed Project driveway were evaluated, and a fire truck turning analysis was performed. Recent vehicular crash records from the New York State Department of Transportation (“NYSDOT”) and from the Village of Buchanan Police Department were analyzed at the intersection of Albany Post Road (New York State Route 9A) with Bleakley Avenue.

PROJECT UNDERSTANDING

The subject property is an undeveloped parcel on the northwest corner of the intersection of Albany Post Road, locally designated as New York State (“NYS”) Route 9A, with Bleakley Avenue. The property has frontage on both roadways. It is proposed to develop the parcel with 11 new condominium / townhouse units, with a small parking area provided for each residence. Access to the Project parcel is to be provided from a proposed driveway on Bleakley Avenue.

TRIP GENERATION

To determine the anticipated trips that the Project will generate, the industry data from the Institute of Transportation Engineers’ (“ITE”) *Trip Generation Manual, 12th Edition*, was utilized. Specifically, data for Land Use Code (“LUC”) 215, *Single-Family Attached Housing*, was reviewed.

Based on LUC 215 from the *Trip Generation Manual*, it was determined that the Project, with 11 attached residential units, would generate on average 5 trips in the AM Peak Hour and 6 trips in the PM Peak Hour.

The Project’s trip generation is summarized in **Table 1**, below.

Table 1 – Trip Generation						
ITE LUC 215 Single-Family Attached Housing	AM Peak Hour			PM Peak Hour		
	Total	Entering	Exiting	Total	Entering	Exiting
	5	1	4	6	3	3

Source: *Trip Generation Manual, 12th Edition*

It is anticipated that the addition of 5 trips in the AM Peak Hour or the addition of 6 trips in the PM Peak Hour will not have a significant impact on the local roadway network. Therefore, from a capacity perspective, the Project is not expected to have a significant adverse impact.

SIGHT DISTANCE EVALUATION

An evaluation of the Project driveway's sight distances was undertaken.

Stopping sight distance was measured along the path required for vehicles to make an emergency stop as they approach the Project driveway from either direction on Bleakley Avenue. The distances were measured from the viewpoint of the approaching vehicles (3.5 feet above the pavement) to the front of a vehicle waiting to exit the Project driveway (with the driver positioned 14.5 feet back from the edge of the traveled way on Bleakley Avenue). The analysis took into consideration the grade on Bleakley Avenue in either direction, as well as the speeds of approaching vehicles.

It is noted that although the Village-wide speed limit is 30 MPH, vehicles approaching the site from the east on Bleakley Avenue will have just turned off Albany Post Road (NYS Route 9A) and will likely be traveling at a considerably lower speed, while vehicles approaching the site from the west on Bleakley Avenue will have to turn left or right onto Albany Post Road (NYS Route 9A) just after the Project driveway and will also likely be slowing down to make those turning movements.

Intersection sight distance was measured along the path vehicles will travel within the acceptable time gap as they approach the Project driveway from either direction on Bleakley Avenue. The distances were measured from the viewpoint of a driver exiting the Project driveway (3.5 feet above the pavement and 14.5 feet back from the edge of the traveled way) to the approaching vehicles (also 3.5 feet above the pavement). It is noted that vehicles turning left from northbound Albany Post Road (NYS Route 9A) onto Bleakley Avenue will be visible for considerably more time than vehicles turning right from southbound Albany Post Road (NYS Route 9A). For this reason, the sight distance evaluation focused on the more critical movement, which was the southbound right-turning movement from Albany Post Road (NYS Route 9A) to Bleakley Avenue. Again, the analysis took into consideration the speeds of approaching vehicles on Bleakley Avenue, as well as the appropriate grade.

A *Policy on Geometric Design of Highways and Streets, 7th Edition*, 2018, also known as the "Green Book" and published by the American Association of State Highway and Transportation Officials ("AASHTO"), was consulted, and a summary of the sight distance evaluation is provided in **Table 2** below, with sight distance exhibits that also indicate the areas where work (regular maintenance and site preparation) must be performed to provide the required sight distances.

Table 2 – Sight Distances		
	Required	Provided
Intersection Sight Distance, Looking Left Exiting Driveway	135 feet ^(A)	135 feet ^(A)
Intersection Sight Distance, Looking Right Exiting Driveway	190 feet ^(B)	190 feet ^(B)
Stopping Sight Distance, on Bleakley Avenue Traveling EB	205 feet ^(C)	210 feet
Stopping Sight Distance, on Bleakley Avenue Traveling WB	130 feet ^(D)	135 feet

Note A: Per AASHTO's "A Policy on Geometric Design of Highways and Streets, 7th Edition, 2018", 135 feet is the required intersection sight distance for vehicles at **14 MPH** with a **6.5-second** time gap, per Case B2 (Right Turns from the Minor Road) in Section 9.5.3.2.2.

Note B: Per AASHTO's "A Policy on Geometric Design of Highways and Streets, 7th Edition, 2018", 190 feet is the required intersection sight distance for vehicles at **17 MPH** with a **7.5-second** time gap, per Case B1 (Left Turns from the Minor Road) in Section 9.5.3.2.1.

Note C: The required stopping sight distance for an eastbound Bleakley Avenue vehicle traveling at **32 MPH** (using NYSDOT Non-National-Highway-System roadway standard).

Note D: The required stopping sight distance for a westbound Bleakley Avenue vehicle traveling at **25 MPH** (using NYSDOT Non-National-Highway-System roadway standard).

For the stopping sight distances, it was assumed that most vehicles making the southbound right-turn movement from Albany Post Road (NYS Route 9A) to Bleakley Avenue would be traveling at 25 MPH or less. To provide the necessary 130 feet of stopping distance, it will be necessary to regrade portions of the site within 25 feet of the edge of the roadway so that the terrain will not obstruct the required sight line. The Project's Civil Engineer has been advised of this requirement (and the requirement not to provide any landscaping or retaining walls in the sight triangles shown in the sight distance exhibits).

It is noted that, should motorists wish to increase their sight lines when they exit the site, they will have the ability to pull forward by approximately 4.5 feet and still have the front of their vehicle about 2 feet off the edge of the road (14.5 feet is the required measurement location; however, a motorist can be positioned 10 feet from the edge of the road while still having the front of the vehicle about 2 feet behind the edge of the traveled way on Bleakley Avenue).

For vehicles approaching the site driveway from the west (i.e., going eastbound) on Bleakley Avenue, it was assumed that most motorists would be traveling at 32 MPH or less. To provide the necessary 205 feet of stopping distance, it will be necessary to clear vegetation in the public right-of-way within 10 feet of the edge of the north side of Bleakley Avenue so as not to obstruct the required sight line.

For the intersection sight distances, it was determined that motorists exiting the Project driveway would not "unduly interfere" (the AASHTO-stated purpose of intersection sight distances) with motorists making the southbound right turn from Albany Post Road (NYS Route 9A) to Bleakley Avenue traveling at less than 15 MPH. For those motorists traveling at 15 MPH or more turning right around the corner, it was determined that the intersection sight distance limit of 135 feet would be acceptable because of the low volume of motorists exiting the Project driveway and because adequate sight distance would be provided to allow them to slow down as much as needed (given that adequate stopping distance is provided). Further, requiring these faster-turning motorists to slow down was also determined not to be undue interference, as they should likely be going slower than 15 MPH around the turn to begin with.

Again, it is noted that motorists exiting the site could increase their sight lines, if they wished, by safely pulling forward by up to 4.5 feet.

For vehicles approaching the site driveway from the west (i.e., going eastbound) on Bleakley Avenue, it was determined that motorists exiting the site driveway would not “unduly interfere” with their progression if they are traveling at less than 18 MPH. For those motorists traveling at 18 MPH or more toward Bleakley Avenue’s intersection with Albany Post Road (NYS Route 9A), it was determined that the intersection sight distance limit of 190 feet would be acceptable because of the low volume of motorists exiting the driveway and because adequate sight distance would be provided to allow them to slow down as much as needed. Further, requiring these faster-traveling motorists to slow down was also determined not to be undue interference, since they would be slowing down as they approach the intersection of Bleakley Avenue with Albany Post Road (NYS Route 9A) anyway.

Although the above analysis indicates that adequate intersection and stopping sight distances for this proposed 11-unit residential project are provided, conditions at the Project driveway on Bleakley Avenue could be improved if the westbound roadway leading away from the Albany Post Road (NYS Route 9A) & Bleakley Avenue intersection were restriped to provide a single lane, as opposed to the through lane and the yielding southbound right-turn lane that presently exist at the intersection (see **Image 1** below). The proposed improvement would eliminate the need for southbound right-turning motorists to yield to motorists who just turned left off of Albany Post Road (NYS Route 9A) onto Bleakley Avenue and, instead, focus on the road ahead of them. If the NYSDOT is willing to permit this restriping, it is recommended that it be implemented by the Project.

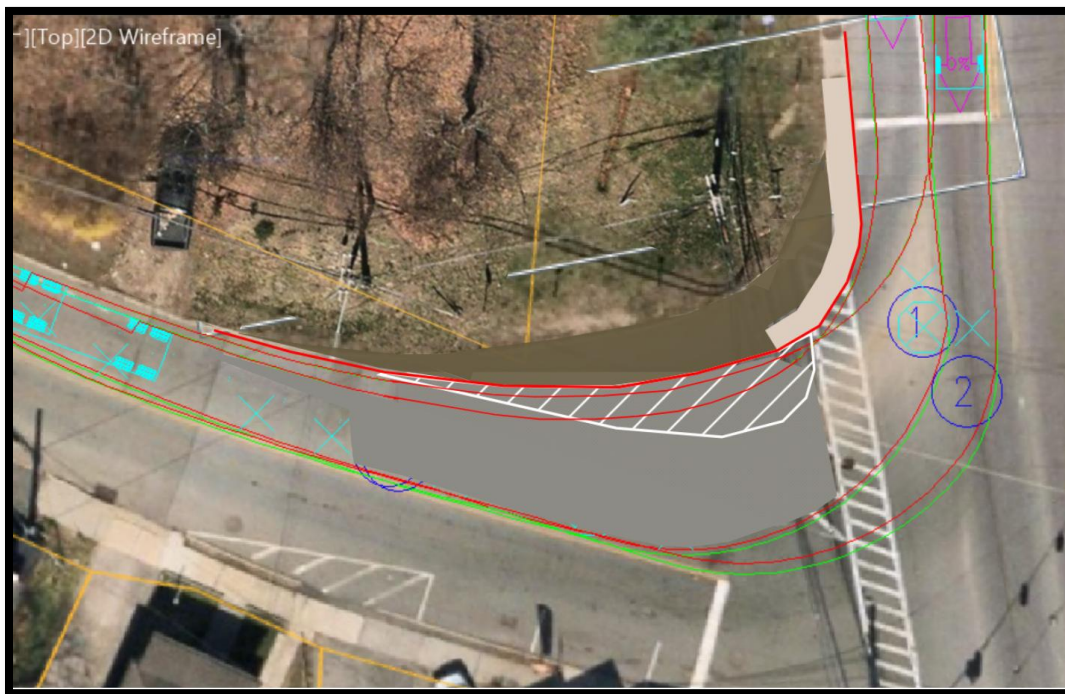


Image 1: Suggested Modification to Westbound Bleakley Avenue at Albany Post Road (NYS Route 9A)



CRASH ANALYSIS

A Freedom of Information Law request was submitted to the NYSDOT on June 30, 2026. The NYSDOT has since furnished Kimley-Horn with said information. Crash data was also obtained from the Village of Buchanan Police Department as well. Kimley-Horn had separately prepared a *Crash Analysis Supplement to Traffic Impact Memorandum*, dated July 23, 2026, that dives into the crash history in detail; this supplement is provided in the Appendix.

As there were no vehicular crashes that were the result of vehicles on Bleakley Avenue, or attempting to turn into Bleakley Avenue, it is anticipated that there will not be a safety concern due to the Project from a crash history perspective.

FIRE TRUCK TURNING

Kimley-Horn has requested the performance specifications for the Village of Buchanan Fire Department's largest responding fire apparatus to confirm that it will be able to negotiate the site. As can be seen from the fire truck turning exhibit, the fire apparatus would be able to drive into the Project site, respond to a call, turn around, and drive out. The fire truck turning exhibit is provided in the Appendix.

CONCLUSIONS

Based on the trip generation evaluation, the proposed 11-unit residential development is anticipated to generate approximately 5 trips during the AM Peak Hour and 6 trips during the PM Peak Hour. Given the limited number of peak-hour trips, the Project is not expected to result in a significant adverse impact to traffic operations on the surrounding roadway network.

The sight distance evaluation also indicates that the available sight distances, with the identified maintenance and site preparation completed, at the proposed Project driveway on Bleakley Avenue satisfy the applicable minimum requirements for intersection and stopping sight distance based on the evaluated travel speeds and roadway conditions. While adequate sight distances are provided, a restriping of Bleakley Avenue has been recommended to improve motorist focus when making a southbound right turn from Albany Post Road (NYS Route 9A) onto Bleakley Avenue, if permitted by the NYSDOT.

Three other developments are proposed in the area (Village Square, AMS, and 501 Broadway), at least two of which had traffic impact studies completed. No significant adverse impacts were identified. The additional 5 trips or 6 trips added by this Project during the AM Peak Hour and PM Peak Hour, respectively, will not meaningfully change future conditions.

Therefore, from a traffic capacity and sight distance perspective (provided the required sight lines are maintained), the proposed Project is expected to operate safely and without significant adverse traffic impacts.


The crash analysis indicated that there were no vehicular crashes that were the result of vehicles on Bleakley Avenue, or attempting to turn into Bleakley Avenue. Therefore, it is anticipated that there will not be a safety concern due to the Project from a crash history perspective.

The fire truck turning analysis currently indicates that the Fire Department's fire apparatus design vehicle would be able to drive into the Project site, respond to a call, turn around, and drive out.

Appendix


- Sight Distance Exhibits
- Preliminary Fire Truck Turning Exhibit
 - Crash Analysis Supplement

Sight Distance Exhibits

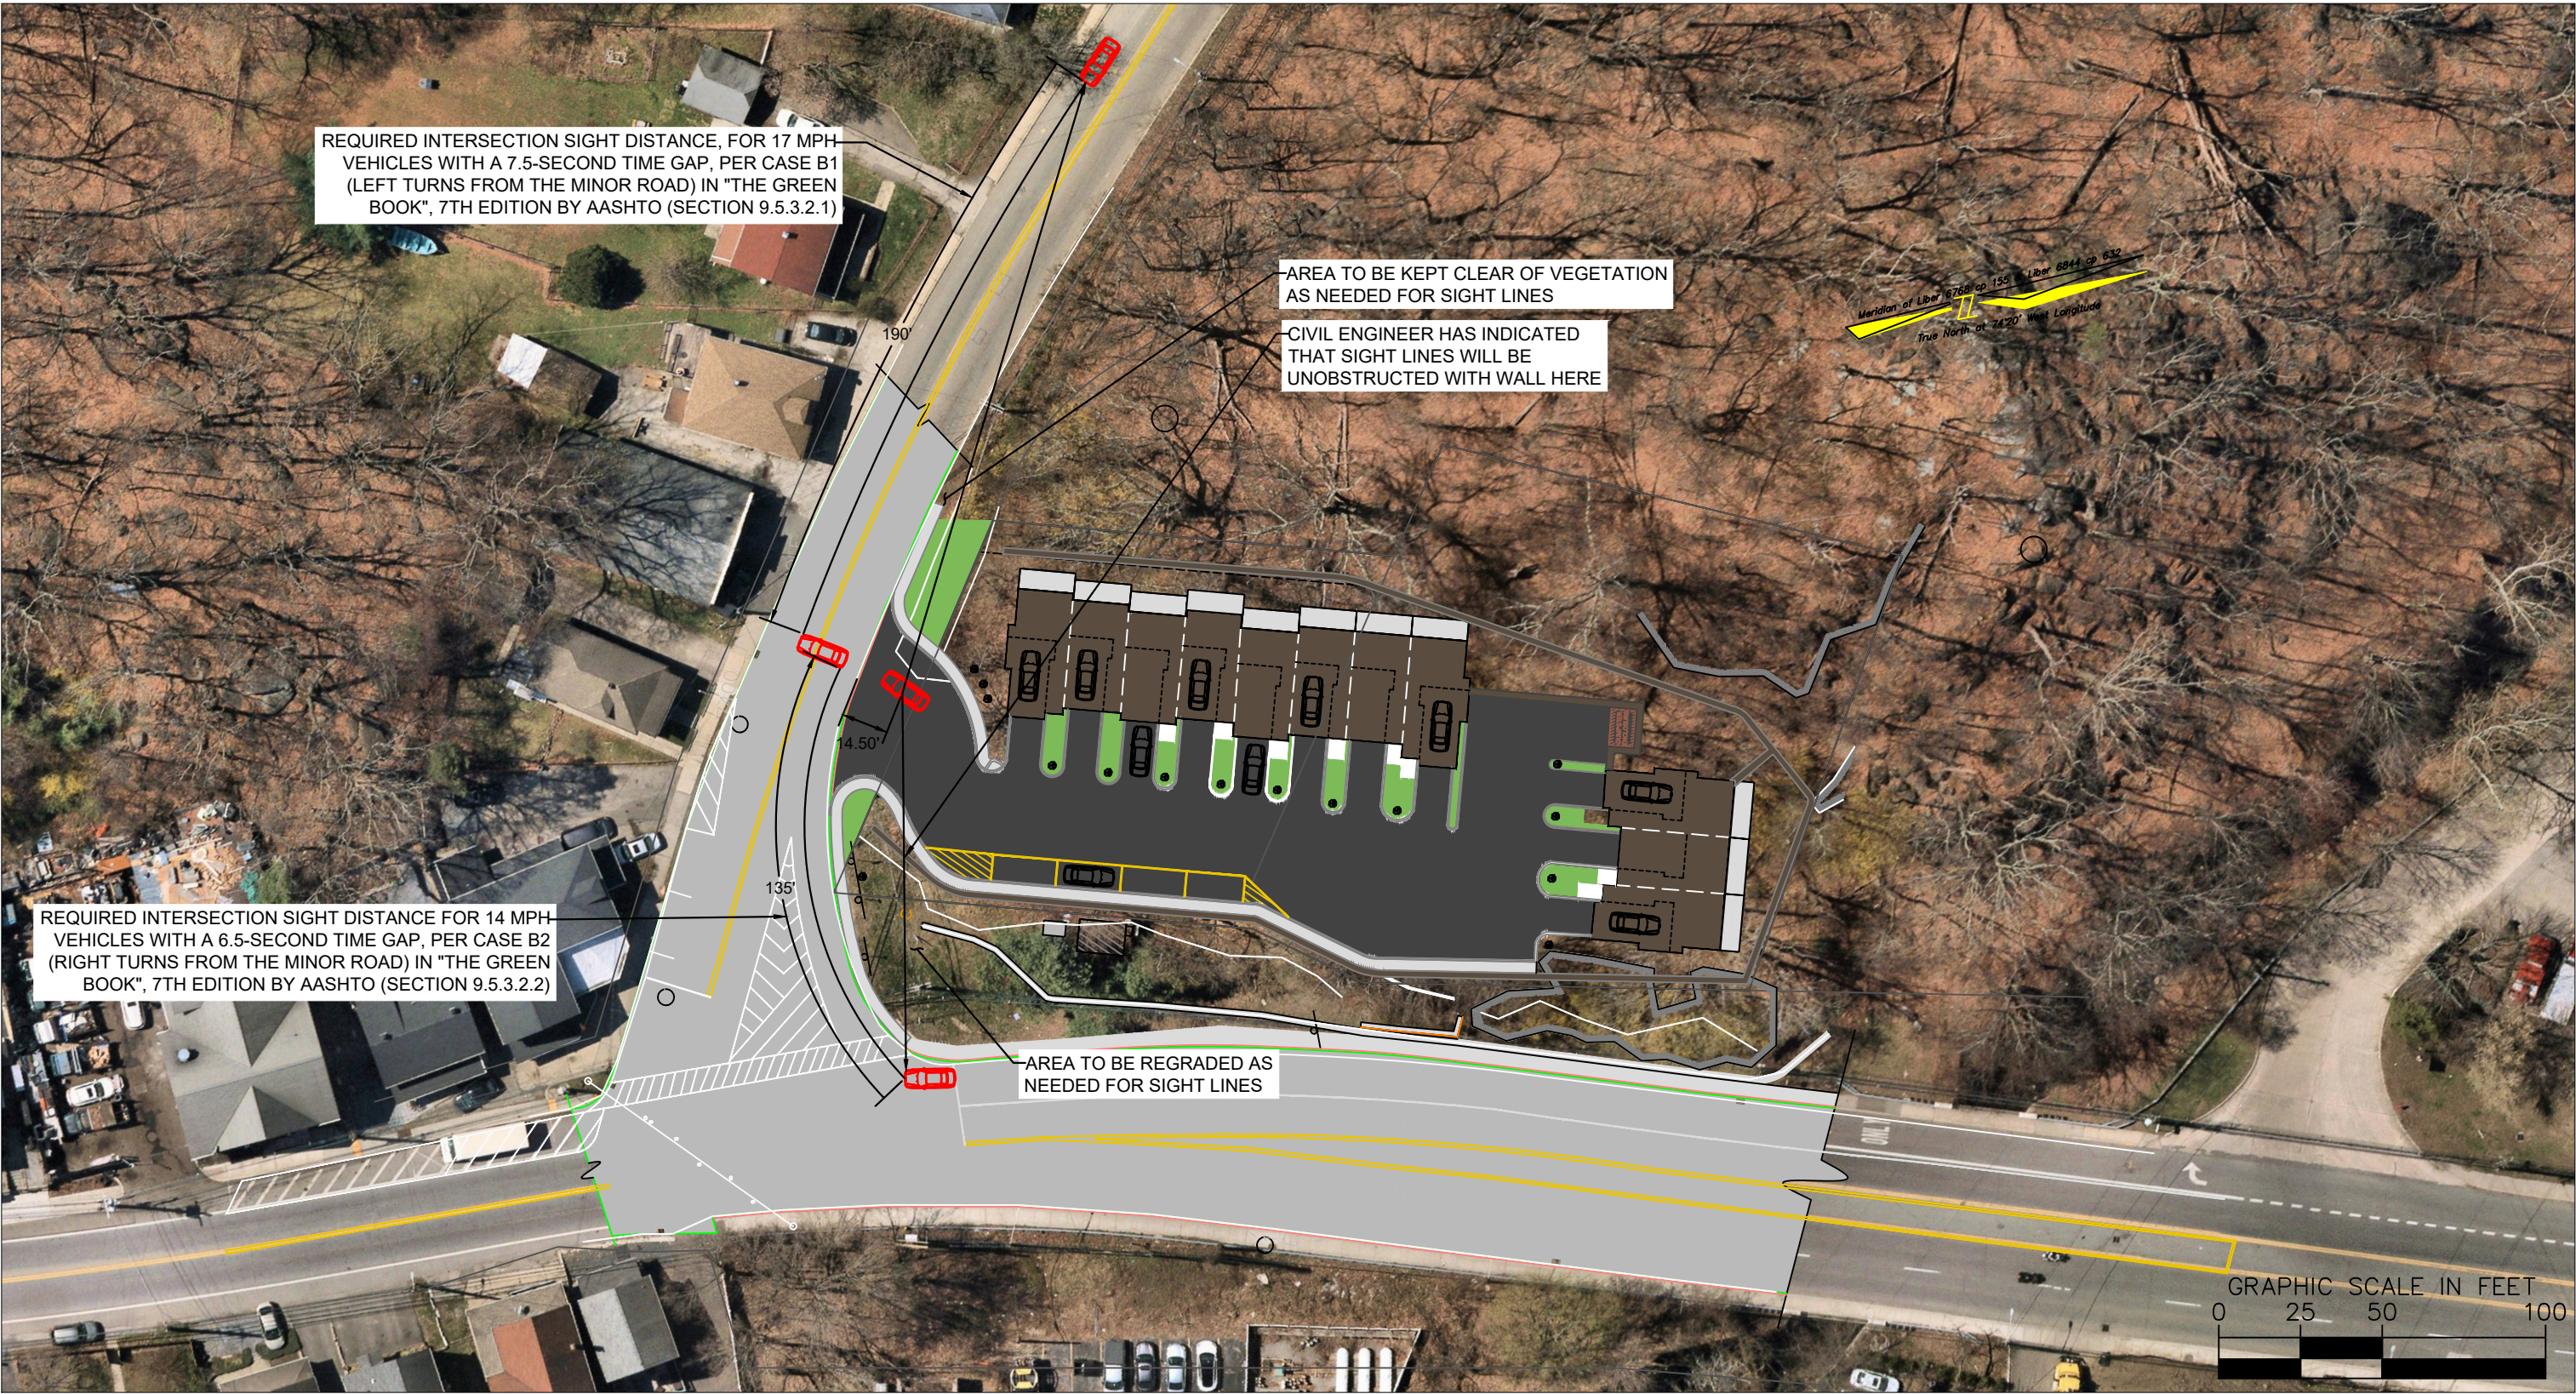

Saved Wednesday, July 15, 2026 10:10:19 AM THOMAS ZHAO Plotted Wednesday, July 15, 2026 10:10:55 AM Zhao, Thomas

SHEET #	PROPOSED RESIDENTIAL 3222 ALBANY POST ROAD VILLAGE OF BUCHANAN, NY	INTERSECTION SIGHT DISTANCE EXHIBIT	PE STAMP: NOT FOR CONSTRUCTION	KHA PROJECT: 112832000	Kimley»Horn New York © 2026 KIMLEY-HORN ENGINEERING AND LANDSCAPE ARCHITECTURE OF NEW YORK, P.C. 1 NORTH LEXINGTON AVENUE, SUITE 505 WHITE PLAINS, NY 10601 PHONE: 914-368-9200 WWW.KIMLEY-HORN.COM	NO.	REVISIONS	DATE	BY
SD-1.0				DATE: 07/15/2026					
				DESIGNED BY: TZ					
				DRAWN BY: TZ					
				CHECKED BY: TJC					

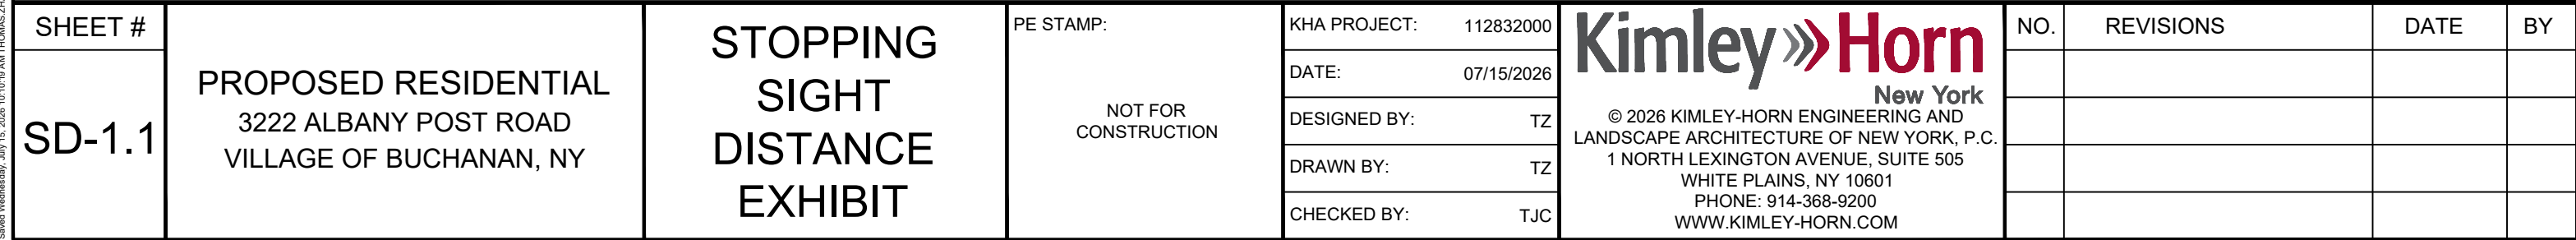

Preliminary Fire Truck Turning Exhibit

Crash Analysis Supplement

MEMORANDUM

To: Mark Giordano
Giordano Industrial

From: John Canning, P.E.
Thomas Zhao, E.I.T.
Kimley-Horn Engineering and Landscape Architecture of New York, P.C.

Date: July 23, 2026

Subject: Proposed Residential Development
3222 Albany Post Road, Village of Buchanan, NY
Crash Analysis Supplement to Traffic Impact Memorandum

Kimley-Horn Engineering and Landscape Architecture of New York, P.C. ("Kimley-Horn") has undertaken and completed a crash history analysis within 500 feet of Albany Post Road (New York State Route 9A) & Bleakley Avenue on behalf of the proposed residential development located at 3222 Albany Post Road in the Village of Buchanan, New York (the "Project"). The findings of said crash analysis are presented below.

CRASH ANALYSIS

Vehicular crash records were obtained from the New York State Department of Transportation ("NYSDOT") and from the Village of Buchanan Police Department, from January 1, 2021 to June 30, 2026, approximately a 5.5-year period.

Based on a review of the crash records, Kimley-Horn determined that there were 11 crashes that occurred within 500 feet of the intersection of Albany Post Road (NYS Route 9A) & Bleakley Avenue. These crash records are attached to this memorandum.

Out of these 11 crashes, 7 crashes were rear-end crashes on Albany Post Road (NYS Route 9A). There was 1 angle crash from an attempted U-turn and 1 sideswipe crash resulting from a failed merge, both on Albany Post Road (NYS Route 9A). An additional 2 miscellaneous crashes (into a fence and against a deer, respectively) were recorded as well. There were no crashes that occurred on Bleakley Avenue and there were no crashes that resulted from a vehicle on Albany Post Road (NYS Route 9A) attempting to turn onto Bleakley Avenue.

It is noted that there was 1 crash that resulted in a fatality involving a speeding vehicle and a parked vehicle. The truck was illegally parked on the side of the road in front of 3212 Albany Post Road when a southbound vehicle, traveling at an high rate of speed, rear-ended the parked truck.

As there are no vehicular crashes that were the result of vehicles on Bleakley Avenue, or attempting to turn into Bleakley Avenue, it is anticipated that there will not be a safety concern due to the Project from a crash history perspective.

Appendix

- Crash Summary Tables
- MV-104 Records

INSERTED AS APPENDIX

Crash Summary Tables

INSERTED AS APPENDIX

Crash Summary by Year 01/01/2021 to 06/30/2026							
Location	No. of Crashes						
	Total	2021	2022	2023	2024	2025	2026
Crashes at Intersections							
Albany Post Road (NYS Route 9A) & Bleakley Avenue	11	2	2	0	3	3	1

Crash Summary by Type 01/01/2021 to 06/30/2026					
Location	No. of Crashes				
	Total	Angle	Rear End	Sideswipe	Other
Crashes at Intersections					
Albany Post Road (NYS Route 9A) & Bleakley Avenue	11	1	7	1	2

Crash Summary by Severity 01/01/2021 to 06/30/2026				
Location	No. of Crashes	Severity		
		No Apparent Injury	Injury	Fatal Injury
Crashes at Intersections				
Albany Post Road (NYS Route 9A) & Bleakley Avenue	11	9	1	1

MV-104 Records

INSERTED AS APPENDIX

POLICE ACCIDENT REPORT

MV-104A (6/04)

AMENDED REPORT

ALL INVOLVED		8	9	10	11	12	13	14	15	16	17 BY						
	A	1	1	4	1	24	M	-	-	-				CILENTO, ADAM D			
	B	2	1	4	1	62	M	-	-	-				DAVILA, PEDRO A			
	C																
	D																
	E																
	F																
Officer's Rank and Signature		PO				Badge/ID No.		NCIC No.		Precint/Post Troop/Zone		Station/Beat Sector		Reviewing Officer		Date/Time Reviewed	
Print Name in Full		A		PALMIETTO		1		05941						FARRELL, S		2/3/2021 07:31	

Local Codes

36694


4W0BD1CRRFFB

POLICE ACCIDENT REPORT

MV-104A (6/04)

☐ AMENDED REPORT

Accident Date			Day of Week	Military Time	No. of Vehicles	No. Injured	No. Killed	Not Investigated at Scene	☐	Left Scene	Police Photos
Month	Day	Year						Accident Reconstructed	☐	☐	☐ Yes ☒ No
1	29	2021	FRIDAY	16:22	2	0	0				

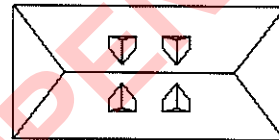

INSERTED AS APPENDIX

POLICE ACCIDENT REPORT

MV-104A (6/04)

Local Codes

37306

4W0CR1D6QBHX

AMENDED REPORT

1	Accident Date Month 5 Day 31 Year 2021 Day of Week MONDAY Military Time 05:28 No. of Vehicles 1 No. Injured 0 No. Killed 0 Not Investigated at Scene ☐ Left Scene ☐ Police Photos ☐ Yes ☒ No Accident Reconstructed ☐	20
2	VEHICLE 1 License ID Number 247371166 Driver Name - exactly as printed on license FURTADO, JONATHAN F Address (Include Number and Street) 709 NELSON AVE City or Town PEEKSKILL State NY Zip Code 105660000 Date of Birth Month 1 Day 23 Year 1993 Sex M Unlicensed ☐ No. of Occupants 01 Public Property Damaged ☐ Name - exactly as printed on registration FURTADO, IGNES J Sex U Date of Birth Month Day Year Address (Include Number and Street) 709 NELSON AVE Apt. No. Haz. Mat. Code Released City or Town PEEKSKILL State NY Zip Code 10566 Plate Number GJH7543 State of Reg. NY Vehicle Year & Make 2009 HOND Vehicle Type SUBN Ins. Code 639 Ticket/Arrest Number(s) Violation Section(s)	21
3	VEHICLE 2 License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed No. of Occupants Public Property Damaged Name - exactly as printed on registration Address (Include Number and Street) Apt. No. Haz. Mat. Code Released City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	22
4	Check if involved vehicle is: V ☐ more than 95 inches wide; E ☐ more than 34 feet long; H ☐ operated with an overweight permit; I ☐ operated with an overdimension permit; C ☐ operated with an overdimension permit. L Box 1 - Point of Impact E Box 2 - Most Damage Enter up to three more damage codes Vehicle By: Towed To: VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER	23
5	Circle the diagram below that describes the accident, or draw your own diagram in space #9. Number the vehicles. Rear End Left Turn Right Angle Right Turn Head On 1. 2. 3. 4. 5. 6. 7. Sideswipe (same direction) Left Turn Right Turn Sideswipe (opposite direction) 8. 9. 10. 11. 12. 13. 14. ACCIDENT DIAGRAM See the last page of the MV-104A for the accident diagram. 9. Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☒ Yes ☐ No	24
6	Reference Marker Coordinates (if available) Latitude/Northing Longitude/Easting Place Where Accident Occurred: County WESTCHESTER ☐ City ☒ Village ☐ Town of BUCHANAN Road on which accident occurred ALBANY POST ROAD (Route Number or Street Name) at 1) intersecting street or 2) .1 feet miles ☒ N ☐ S of BLEAKLEY AVENUE (Route Number or Street Name) ☐ E ☐ W (Milepost, Nearest Intersecting Route Number or Street Name)	25
7	Accident Description/Officer's notes V1 SB ALBANY POST ROAD. DEER CROSSING ROADWAY WB. V1 OPERATOR STATES DEER CROSSED INTO HIS LANE OF TRAVEL AND WAS UNABLE TO STOP BEFORE COLLISION WITH DEER CAUSING DAMAGE TO V1. WHAT APPEARS TO BE DEER HAIR LOCATED ON V1 AT TIME OF REPORT.	26

ALL INVOLVED	8	9	10	11	12	13	14	15	16	17 BY		
A	1	1	4	1	28	M	-	-	-		FURTADO, JONATHAN F	
B												
C												
D												
E												
F												
Officer's Rank and Signature	PO	DAVID REGG				Badge/ID No.	2	NCIC No.	05941	Precinct/Post Troop/Zone	Station/Beat Sector	
Print Name in Full	DAVID REGG				2	05941				Reviewing Officer	Date/Time Reviewed	
								FARRELL, S				6/7/2021 08:34

Local Codes

37306


4W0CR1D6QBHX

POLICE ACCIDENT REPORT

MV-104A (6/04)

☐ AMENDED REPORT

Accident Date			Day of Week	Military Time	No. of Vehicles	No. Injured	No. Killed	Not Investigated at Scene	☐ Left Scene	Police Photos
Month	Day	Year						Accident Reconstructed	☐	☐ Yes ☒ No
5	31	2021	MONDAY	05:28	1	0	0			

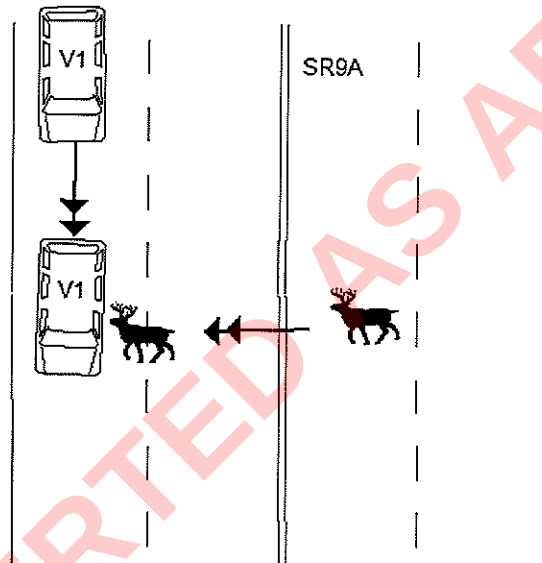

Local Codes
0544100
4W0BD1D8NKFB

POLICE ACCIDENT REPORT

MV-104A (6/04)

☐ AMENDED REPORT

1	Accident Date Month 6 Day 18 Year 2021	Day of Week FRIDAY	Military Time 07:45	No. of Vehicles 2	No. Injured 1	No. Killed 0	Not Investigated at Scene ☐	Left Scene ☐	Police Photos ☐ Yes ☒ No	19 X	
2	VEHICLE 1				VEHICLE 2 ☒ BICYCLIST ☐ PEDESTRIAN ☐ OTHER PEDESTRIAN						20 X
2	VEHICLE 1 - Driver License ID Number 162359897 Driver Name - exactly as printed on license NIKOLA, NICHOLAS P Address (Include Number and Street) 95 DOGTAIL CORNERS RD City or Town WINGDALE State NY Zip Code 12594 Date of Birth Month 11 Day 18 Year 1986 Sex M Unlicensed ☐ No. of Occupants 01 Public Property Damaged ☐ Name - exactly as printed on registration 5050; TRUCKING, INC; Address (Include Number and Street) 15 DYKEMAN LN City or Town PAWLING State NY Zip Code 12564 Plate Number 30035TC State of Reg. NY Vehicle Year & Make 2020 PTRB Vehicle Type DELV Ins. Code 113 Ticket/Arrest Number(s)				VEHICLE 2 - Driver License ID Number 588227220 Driver Name - exactly as printed on license GUZMAN, OLGA M Address (Include Number and Street) 1020 CONSTANT AVE APT 2 City or Town PEEKSKILL State NY Zip Code 10566 Date of Birth Month 5 Day 19 Year 1969 Sex F Unlicensed ☐ No. of Occupants 01 Public Property Damaged ☐ Name - exactly as printed on registration GUZMAN, OLGA M Address (Include Number and Street) 1020 CONSTANT AVE APT 2 City or Town PEEKSKILL State NY Zip Code 10566 Plate Number HUN8535 State of Reg. NY Vehicle Year & Make 2001 SUBA Vehicle Type 4DSD Ins. Code 743 Ticket/Arrest Number(s)						21 4
3	1				1						22 13
4	1				1						23 5
5	3				5						24 5
6	1				1						25 1
7	1				1						26 1
8	1				1						27 1
9	1				1						28 1
10	1				1						29 1
11	1				1						30 1

Check if involved vehicle is:
☐ more than 95 inches wide;
☒ more than 34 feet long;
☐ operated with an overweight permit;
☐ operated with an overdimension permit.

VEHICLE 1 DAMAGE CODES
 Box 1 - Point of Impact 4 1 3
 Box 2 - Most Damage 3 4 5
 Enter up to three more damage codes 4

Vehicle By:
Towed To:

VEHICLE DAMAGE CODING:
 1-13 SEE DIAGRAM ON RIGHT.
 14. UNDERCARRIAGE 17. DEMOLISHED
 15. TRAILER 18. NO DAMAGE
 16. OVERTURNED 19. OTHER

Check if involved vehicle is:
☐ more than 95 inches wide;
☐ more than 34 feet long;
☐ operated with an overweight permit;
☐ operated with an overdimension permit.

VEHICLE 2 DAMAGE CODES
 Box 1 - Point of Impact 11 1 11
 Box 2 - Most Damage 3 4 5
 Enter up to three more damage codes

Vehicle By:
Towed To:

Circle the diagram below that describes the accident, or draw your own diagram in space #9. Number the vehicles.

ACCIDENT DIAGRAM

See the last page of the MV-104A for the accident diagram.

Cost of repairs to any one vehicle will be more than \$1000.
☐ Unknown/Unable to determine ☒ Yes ☐ No

Reference Marker Coordinates (if available)
 Latitude/Northing
 Longitude/Easting

Place Where Accident Occurred:
 County WESTCHESTER ☐ City ☒ Village ☐ Town of BUCHANAN
 Road on which accident occurred ALBANY POST RD (Route Number or Street Name)
 at 1) intersecting street
 or 2) 1000 feet miles ☒ N ☐ S of BLEAKLEY AVE (Route Number or Street Name)
☐ E ☐ W (Milepost, Nearest intersecting Route Number or Street Name)

Accident Description/Officer's notes
 Video footage recored by V#1's Dash cam revealed, V#1 driving South on Albany Post Rd in the through travel lane near the Iron Bridge where V#2 did move from the right turn only lane in to travel lane of V#1 causing damage to the front passenger side of V#1 and drivers door of V#2.

ALL INVOLVED	8	9	10	11	12	13	14	15	16	17 BY		
A	1	1	4	1	34	M	-	-	-		NIKOLA, NICHOLAS P	
B	2	1	4	1	52	F	04	12	6	9993 5908	GUZMAN, OLGA M	
C												
D												
E												
F												
Officer's Rank and Signature	SGT					Badge/ID No.	NCIC No.		Precinct/Post Troop/Zone	Station/Beat Sector	Reviewing Officer	Date/Time Reviewed
Print Name in Full	A PALMIETTO					1	05941				FARRELL, S	6/21/2021 08:25

Local Codes

0544100



4W0BD1D8NKFB

POLICE ACCIDENT REPORT

MV-104A (6/04)

☐ AMENDED REPORT

Accident Date			Day of Week	Military Time	No. of Vehicles	No. Injured	No. Killed	Not Investigated at Scene	☐ Left Scene	Police Photos
Month	Day	Year						Accident Reconstructed	☐	☐ Yes ☒ No
6	18	2021	FRIDAY	07:45	2	1	0			

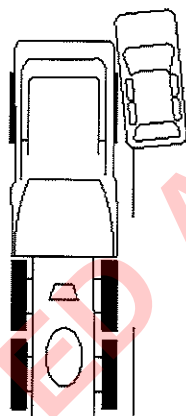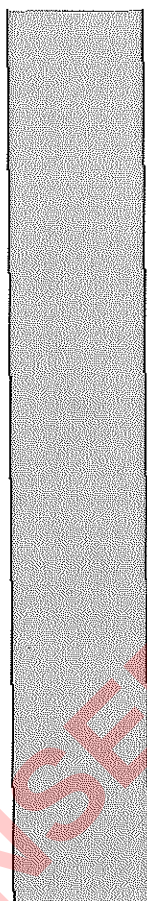

INSERTED AS APPENDIX

POLICE ACCIDENT REPORT

MV-104A (6/04)

Local Codes
0544100
4W0CR1DPHKBF

☐ AMENDED REPORT

1	Accident Date Month: 10, Day: 16, Year: 2021	Day of Week SATURDAY	Military Time 17:35	No. of Vehicles 2	No. Injured 0	No. Killed 0	Not Investigated at Scene ☐	Left Scene ☐	Police Photos ☐ Yes ☒ No	19	
2	VEHICLE 1				☒ VEHICLE 2 ☐ BICYCLIST ☐ PEDESTRIAN ☐ OTHER PEDESTRIAN						20
2	VEHICLE 1- Driver License ID Number: 953450434 Driver Name - exactly as printed on license: BARBERAN, JOHNNY C Address (Include Number and Street): 2081 ALBANY PST RD 2 City or Town: MONTROSE, State: NY, Zip Code: 105480000 Date of Birth: 10/16/1958, Sex: M, Unlicensed: ☐ Name - exactly as printed on registration: BARBERAN, JOHNNY C Address (Include Number and Street): 2081 ALBANY PST RD 2 City or Town: MONTROSE, State: NY, Zip Code: 10548-0000 Plate Number: HKJ6366, State of Reg: NY, Vehicle Year & Make: 2002 NISS, Vehicle Type: 4DSD, Ins. Code: 639				VEHICLE 2- Driver License ID Number: 254893446 Driver Name - exactly as printed on license: ORTIZ, RAVEN SIMONE DUBOIS Address (Include Number and Street): 1431 PARK ST APT 2M City or Town: PEEKSKILL, State: NY, Zip Code: 105660000 Date of Birth: 9/19/1990, Sex: F, Unlicensed: ☐ Name - exactly as printed on registration: ORTIZ, RAVEN S Address (Include Number and Street): 1431 PARK ST APT 2M City or Town: PEEKSKILL, State: NY, Zip Code: 10566 Plate Number: JRS5125, State of Reg: NY, Vehicle Year & Make: 2017 HOND, Vehicle Type: 4DSD, Ins. Code: 100				21		
3	Ticket/Arrest Number(s): Violation Section(s): 1				Ticket/Arrest Number(s): Violation Section(s): 1						22
4	Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit.				Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit.						23
5	VEHICLE 1 DAMAGE CODES Box 1 - Point of Impact: 1, 8 Box 2 - Most Damage: 8, 1 Enter up to three more damage codes: 9, 4, 5 Vehicle By: _____ Towed To: _____ VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER				VEHICLE 2 DAMAGE CODES Box 1 - Point of Impact: 1, 2, 3 Box 2 - Most Damage: 2, 3, 4 Enter up to three more damage codes: 3, 4, 5 Vehicle By: _____ Towed To: _____						24
6	Circle the diagram below that describes the accident, or draw your own diagram in space #9. Number the vehicles.				ACCIDENT DIAGRAM 9. Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☐ Yes ☒ No						25
7	Reference Marker: _____ Coordinates (if available): Latitude/Northing: _____ Longitude/Easting: _____				Place Where Accident Occurred: County: WESTCHESTER ☐ City ☒ Village ☐ Town of BUCHANAN Road on which accident occurred: ALBANY POST RD (Route Number or Street Name) at 1) intersecting street: BLEAKLEY AVE (Route Number or Street Name) or 2) _____ (Milepost, Nearest intersecting Route Number or Street Name)						26
8	Accident Description/Officer's notes: Driver 1 stated that he was stopped at the above intersection. Driver 1 stated the that he started to proceed and then stopped due traffic. Driver 2 stated the same as Driver 1. Collision occurred at the above intersection.										27

ALL INVOLVED	8	9	10	11	12	13	14	15	16	17 BY	
A	1	1	2	1	63	M	-	-	-	BARBERAN, JOHNNY C	
B	2	1	2	1	31	F	-	-	-	ORTIZ, RAVEN SIMONE	
C											
D											
E											
F											
Officer's Rank and Signature	PO [Signature]					Badge/ID No.	NCIC No.	Precinct/Post Troop/Zone	Station/Beat Sector	Reviewing Officer	Date/Time Reviewed
Print Name in Full	R. BUDDE					7	05941			FARRELL, S	10/18/2021 13:08

POLICE ACCIDENT REPORT

Local Codes
38538
4W0CR1F6TJQ9

MV-104A (6/04)

☐ AMENDED REPORT

1	Accident Date Month 3 Day 9 Year 2022	Day of Week WEDNESDAY	Military Time 11:22	No. of Vehicles 2	No. Injured 0	No. Killed 0	Not Investigated at Scene ☐	Left Scene ☐	Police Photos ☐ Yes ☒ No	19 42
2	VEHICLE 1 License ID Number 134412979 Driver Name - exactly as printed on license LEON ROJAS, DARIO ANTONIO Address (Include Number and Street) 4 BLELOCH AVE City or Town PEEKSKILL State NY Zip Code 105660000 Date of Birth Month 9 Day 22 Year 1981 Sex M Unlicensed ☐ No. of Occupants 02 Public Property Damaged ☐ Name - exactly as printed on registration LOJACOBOS, JHOANA M Sex F Date of Birth Month 12 Day 1 Year 1980 Address (Include Number and Street) 4 BLELOCH AVE APT 1 City or Town PEEKSKILL State NY Zip Code 10566 Plate Number JFL6715 State of Reg. NY Vehicle Year & Make 2010 HOND Vehicle Type SUBN Ins. Code 113 Ticket/Arrest Number(s)				VEHICLE 2 License ID Number 634825956 Driver Name - exactly as printed on license CARCHIPULLA, MIGUEL A Address (Include Number and Street) 320 N BROAD ST APT 1 City or Town PEEKSKILL State NY Zip Code 105660000 Date of Birth Month 1 Day 20 Year 1978 Sex M Unlicensed ☐ No. of Occupants 01 Public Property Damaged ☐ Name - exactly as printed on registration CARCHIPULLA, MANUEL P Sex M Date of Birth Month 2 Day 15 Year 1979 Address (Include Number and Street) 425 DYCKMAN ST City or Town PEEKSKILL State NY Zip Code 10566 Plate Number HVD8018 State of Reg. NY Vehicle Year & Make 2006 HOND Vehicle Type 4DSD Ins. Code 328 Ticket/Arrest Number(s)				20 7	
3	VEHICLE 1 DAMAGE CODES Box 1 - Point of Impact 1 Box 2 - Most Damage 3 Enter up to three more damage codes 1				VEHICLE 2 DAMAGE CODES Box 1 - Point of Impact 12 Box 2 - Most Damage 12 Enter up to three more damage codes 2				21 -	
4	VEHICLE 1 DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER				VEHICLE 2 DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER				22 -	
5	Reference Marker 9 Coordinates (if available) Latitude/Northing 8 7 0 3 Longitude/Easting 2 2 4 9				Place Where Accident Occurred: County WESTCHESTER City ☐ Village ☒ Town of BUCHANAN Road on which accident occurred ALBANY POST ROAD (Route Number or Street Name) at 1) intersecting street or 2) 250 feet miles of BLEAKLEY AVENUE (Route Number or Street Name) (Milepost, Nearest intersecting Route Number or Street Name)				23 1	
6	Accident Description/Officer's notes V1 TRAVELING NORTHBOUND IN LANE 1 ON STATE ROUTE 9A. V2 TRAVELING NORTHBOUND ON STATE ROUTE 9A. V1 FAILS TO YIELD RIGHT AWAY TO V2 WHILE MERGING INTO LANE 2 STRIKING V2 CAUSING DAMAGE TO BOTH VEHICLES. V1 OPERATOR STATES BRAKES WEREN'T FUNCTIONING PROPERLY.				9. Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☒ Yes ☐ No				24 1	

ALL INVOLVED	8	9	10	11	12	13	14	15	16	17 BY	
A	1	1	4	1	40	M	-	-	-		LEON ROJAS, DARIO A
B	1	3	4	1	41	F	-	-	-		LOJACOBOS, JHOANA M
C	2	1	4	1	44	M	-	-	-		CARCHIPULLA, MIGUEL
D											
E											
F											
Officer's Rank and Signature	PO <i>DAVID REGG</i>					Badge/ID No.	NCIC No.	Precinct/Post Troop/Zone	Station/Beat Sector	Reviewing Officer	Date/Time Reviewed
Print Name in Full	DAVID REGG					2	05941			PALMIETTO, A	3/10/2022 07:05

Local Codes

38538

POLICE ACCIDENT REPORT


MV-104A (6/04)

4W0CR1F6TJQ9

☐ AMENDED REPORT

Accident Date			Day of Week	Military Time	No. of Vehicles	No. Injured	No. Killed	Not Investigated at Scene	☐	Left Scene	Police Photos
Month	Day	Year						Accident Reconstructed	☐	☐	☐ Yes ☒ No
3	9	2022	WEDNESDAY	11:22	2	0	0				

SR9A

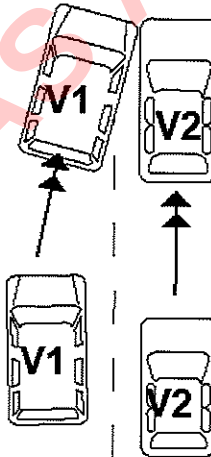

POLICE ACCIDENT REPORT

MV-104A (6/04)

Local Codes
39437
4W0CR1FWB20S

☐ AMENDED REPORT



1	Accident Date Month 9 Day 17 Year 2022 Day of Week SATURDAY Military Time 12:25 No. of Vehicles 2 No. Injured 0 No. Killed 0 Not Investigated at Scene ☐ Left Scene ☐ Police Photos ☐ Yes ☒ No Accident Reconstructed ☐	20
2	VEHICLE 1 License ID Number 609489961 Driver Name - exactly as printed on license KUMPH, MUIR Address (Include Number and Street) 20 CLEVELAND DR City or Town CROTON ON HUDSO State NY Zip Code 105200000 Date of Birth 8/21/1971 Sex M Unlicensed ☐ No. of Occupants 02 Public Property Damaged ☐ Name - exactly as printed on registration KUMPH, MUIR Address (Include Number and Street) 20 CLEVELAND DR City or Town CROTON ON HUDS State NY Zip Code 10520 Plate Number HZR8006 State of Reg. NY Vehicle Year & Make 2021 CHEV Vehicle Type 4DSD Ins. Code 328 Ticket/Arrest Number(s) Violation Section(s) Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit. VEHICLE 1 DAMAGE CODES Box 1 - Point of Impact 7 1 7 Box 2 - Most Damage 3 4 5 Enter up to three more damage codes 8 Vehicle By: Towed To: VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER	21
2	VEHICLE 2 License ID Number 545697025 Driver Name - exactly as printed on license DALTON, THOMAS JAMES Address (Include Number and Street) 15 OAKWOOD DR 123 City or Town PEEKSKILL State NY Zip Code 105660000 Date of Birth 3/1/1977 Sex M Unlicensed ☐ No. of Occupants 01 Public Property Damaged ☐ Name - exactly as printed on registration DALTON, THOMAS J Address (Include Number and Street) 15 OAKWOOD DR 123 City or Town PEEKSKILL State NY Zip Code 10566 Plate Number KMG1386 State of Reg. NY Vehicle Year & Make 2011 HOND Vehicle Type 4DSD Ins. Code 724 Ticket/Arrest Number(s) Violation Section(s) Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit. VEHICLE 2 DAMAGE CODES Box 1 - Point of Impact 2 1 2 Box 2 - Most Damage 3 4 1 Enter up to three more damage codes 2 Vehicle By: Towed To: VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER	22
3	Circle the diagram below that describes the accident, or draw your own diagram in space #9. Number the vehicles. Diagram showing vehicle 1 (left) and vehicle 2 (right) with arrows indicating movement. Vehicle 1 is marked with a circle and arrow pointing right. Vehicle 2 is marked with a circle and arrow pointing left. The diagrams are labeled: Rear End, Left Turn, Right Angle, Right Turn, Head On, Sideswipe (same direction), Left Turn, Right Turn, Sideswipe (opposite direction). 9. Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☒ Yes ☐ No	23
4	Reference Marker 9 A Coordinates (if available) Latitude/Northing 8 7 0 3 Longitude/Easting 2 2 4 9 Place Where Accident Occurred: County WESTCHESTER City ☐ Village ☒ Town ☐ of BUCHANAN Road on which accident occurred ALBANY POST ROAD (SR9A) at 1) intersecting street BLEAKLEY AVENUE or 2) ☐ N ☐ S ☐ E ☐ W of ☐ (Milepost, Nearest intersecting Route Number or Street Name) Accident Description/Officer's notes V1 AND V2 TRAVELING NORTHBOUND ON ALBANY POST ROAD. V1 OPERATOR STATES HE OBSERVED AN EMERGENCY EMS VEHICLE WITH LIGHTS ACTIVATED TRAVELING NORTHBOUND BEHIND HIM SO HE YIELDS RIGHT OF WAY TO EMERGENCY VEHICLE BY COMING TO A STOP. HE WAS THEN STRUCK FROM BEHIND BY V2. V2 OPERATOR STATES HE OBSERVED EMS VEHICLE HOWEVER DIDNT BELIEVE IT WAS GOING TO A CALL FOR SERVICE. V2 OPERATOR STATES HE THEN STRUCK V1. BOTH VEHICLES SUSTAINED DAMAGE FROM	24

ALL INVOLVED	8	9	10	11	12	13	14	15	16	17 BY		
A	1	1	4	1	51	M	-	-	-	KUMPH, MUIR		
B	1	3	4	1	9	F	-	-	-	KUMPH, LEVIN		
C	2	1	4	1	45	M	-	-	-	DALTON, THOMAS JAME		
D												
E												
F												
Officer's Rank and Signature	PO	DAVID REGG				Badge/ID No.	2	NCIC No.	05941	Station/Beat Sector	Reviewing Officer	Date/Time Reviewed
Print Name in Full	DAVID REGG					2		05941		PALMIETTO, A		9/19/2022 12:05

Local Codes
39437
4W0CR1FWB20S

AMENDED REPORT

MV-104A (6/04)

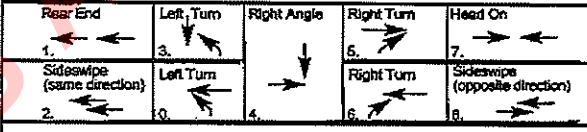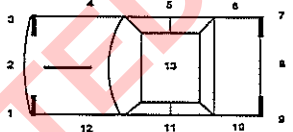1	Accident Date Month: 9 Day: 17 Year: 2022 Day of Week: SATURDAY Military Time: 12:25 No. of Vehicles: 2 No. Injured: 0 No. Killed: 0 Not Investigated at Scene: ☐ Left Scene: ☐ Police Photos: ☒ Yes ☐ No															20
	Accident Reconstructed: ☐ BICYCLIST: ☐ PEDESTRIAN: ☐ OTHER PEDESTRIAN: ☐															
2	VEHICLE - Driver License ID Number: _____ State of Lic.: _____ Driver Name - exactly as printed on license: _____ Address (Include Number and Street): _____ Apt. No.: _____ City or Town: _____ State: _____ Zip Code: _____ Date of Birth: _____ Sex: _____ Unlicensed: ☐ No. of Occupants: _____ Public Property Damaged: ☐ VEHICLE - Driver License ID Number: _____ State of Lic.: _____ Driver Name - exactly as printed on license: _____ Address (Include Number and Street): _____ Apt. No.: _____ City or Town: _____ State: _____ Zip Code: _____ Date of Birth: _____ Sex: _____ Unlicensed: ☐ No. of Occupants: _____ Public Property Damaged: ☐															21
3	Name: _____ Sex: _____ Date of Birth: _____ Year: _____ Address (Include Number and Street): _____ Apt. No.: _____ Haz. Mat. Code: _____ Released: ☐ Name: _____ Sex: _____ Date of Birth: _____ Year: _____ Address (Include Number and Street): _____ Apt. No.: _____ Haz. Mat. Code: _____ Released: ☐															22
4	City or Town: _____ State: _____ Zip Code: _____ Plate Number: _____ State of Reg.: _____ Vehicle Year & Make: _____ Vehicle Type: _____ Ins. Code: _____ Ticket/Arrest Number(s): _____ City or Town: _____ State: _____ Zip Code: _____ Plate Number: _____ State of Reg.: _____ Vehicle Year & Make: _____ Vehicle Type: _____ Ins. Code: _____ Ticket/Arrest Number(s): _____															23
5	Violation Section(s): _____ Violation Section(s): _____															24
6	Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit. Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit.															25
7	VEHICLE DAMAGE CODES Box 1 - Point of Impact: _____ Box 2 - Most Damage: _____ Enter up to three more damage codes: _____ Vehicle By: _____ Towed To: _____ VEHICLE DAMAGE CODES Box 1 - Point of Impact: _____ Box 2 - Most Damage: _____ Enter up to three more damage codes: _____ Vehicle By: _____ Towed To: _____ Circle the diagram below that describes the accident, or draw your own diagram in space #9. Number the vehicles. 															26
	VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER  ACCIDENT DIAGRAM 9. Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☐ Yes ☐ No															27
	Reference Marker: _____ Coordinates (if available): _____ Latitude/Northing: _____ Longitude/Easting: _____ Place Where Accident Occurred: County: <u>WESTCHESTER</u> ☐ City ☐ Village ☐ Town of _____ Road on which accident occurred: _____ at 1) intersecting street _____ (Route Number or Street Name) or 2) _____ of _____ (Route Number or Street Name) feet _____ miles _____ (Milepost, Nearest intersecting Route Number or Street Name)															28
	Accident Description/Officer's notes ACCIDENT .															29
																30

ALL INVOLVED	A	8	9	10	11	12	13	14	15	16	17 BY							
	B																	
	C																	
	D																	
	E																	
	F																	
Officer's Rank and Signature		PO <i>DAVID REGG</i>					Badge/ID No.		NCIC No.		Precinct/Post Troop/Zone		Station/Beat Sector		Reviewing Officer		Date/Time Reviewed	
Print Name in Full		DAVID REGG					2		05941						PALMIETTO, A		9/19/2022 12:05	

POLICE ACCIDENT REPORT

MV-104A (6/04)

☐ AMENDED REPORT

ALL IN VOL VED	8	9	10	11	12	13	14	15	16	17 BY							
	A	1	1	7	1	29	F	01	15	2	9993	5905	IRELAND, JENNIFER A	2/27/2024			
	B																
	C																
	D																
	E																
	F																
Officer's Rank and Signature						Badge/ID No.		NCIC No.		Precinct/Post Troop/Zone		Station/Beat Sector		Reviewing Officer		Date/Time Reviewed	
DET 						5		05941						TIERNAN, J		3/21/2024 12:36	
Print Name in Full																	
C LOERTSCHER																	


Local Codes
IN-24-020258
4W0CR2HR8CH9

POLICE ACCIDENT REPORT

MV-104A (6/04)

☐ AMENDED REPORT

Accident Date			Day of Week	Military Time	No. of Vehicles	No. Injured	No. Killed	Not Investigated at Scene	☐ Left Scene	Police Photos
Month	Day	Year						Accident Reconstructed	☒	☒ Yes ☐ No
2	23	2024	FRIDAY	21:44	2	0	1			

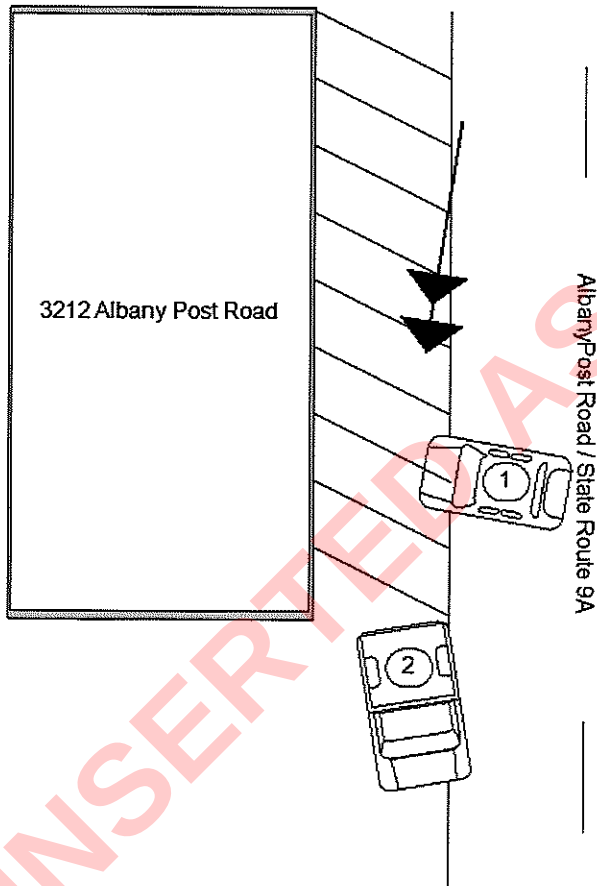

Not to scale



POLICE REPORT FOR FATAL MOTOR VEHICLE ACCIDENTS



MV-104D (3/02)

Page 1 of 1 Pages

Local Code IN-24-020258 4W0CR2HR8CH9	Accident Date Month Day Yr. 02 23 2024	Military Time 21:44	County WESTCHESTER	City/Town/Village BUCHANAN, VILLAGE	No. Killed 1	No. Vehicles 2	Work Related ☐ Yes ☒ No
Name and Address of Deceased 1: IRELAND, JENNIFER A 3914 W WALNUT ST TAMPA FL 33607							

ACCIDENT DATA

Speed Limit (MPH) 30	Location (Route or Street Name) ALBANY POST ROAD
Estimated Speed: Vehicle 1 70 MPH ☐ Unknown Vehicle 2 0 MPH ☐ Unknown Vehicle MPH ☐ Unknown	
Vehicle Model (for example, Mustang or Corvette): Vehicle 1 ALTIMA Vehicle 2 XXX Vehicle	
Roadway Surface: ☐ Concrete ☒ Blacktop ☐ Brick or Block ☐ Dirt ☐ Slag ☐ Gravel ☐ Stone ☐ Other	
No. of Lanes 2	Roadway Flow: ☐ One Way Traffic ☐ Divided highway, median strip ☒ Not physically divided ☐ Divided highway, other barrier or barrier type unknown
EMERGENCY MEDICAL SERVICES * Time (Military): Notified 21:44 Arrived at Scene 21:51 Arrived at Hospital 22:38	
HOSPITAL INFORMATION If the victim was taken to a hospital outside of NYS, give name, county and state of that hospital: 1: WESTCHESTER - WESTCHESTER COUNTY MEDICAL CENTER If the victim was transferred to another hospital (after initial transportation), give the name, county and state of that hospital:	

OCCUPANT DATA

Name	Deceased Yes/No	Time of Death	Extricated Yes/No**	Type of Extrication Equip. Used	Air Bags Deployed Yes/No	Not in Vehicle	Initial Point of Impact to Vehicle***
V Driver E IRELAND, JENNIFER A H I Passenger C L E Passenger 1	YES	21:21	YES	JAW, CUTTER, RAM	YES	NO	02 - FRONT CENTER
V Driver E PARKED, H I Passenger C L E Passenger 2							08 - REAR CENTER
V E H I Passenger C L E Passenger							

* This includes any type of EMS service (for example, fire, police, private). If you are unable to furnish the EMS data, please give the name, address and plate number of the ambulances so we can contact them:

** To be "extricated", the victim must be pried from the wreckage. Unfastening the seat belt is not considered "extricated".

*** Indicate the first area of the vehicle that was impacted, for example, right front, undercarriage.

Additional Information

SIGN HERE	Officer's Rank and Signature DET [Signature]	Badge/ID No 5	Department 05941	Precinct/Post Troop/Zone	Station/Beat/ Sector	Reviewing Officer TIERNAN, J	Date/Time Reviewed 3/21/2024 12:36
	Print Name in Full C LOERTSCHER						

POLICE ACCIDENT REPORT

MV-104A (6/04)

☐ **AMENDED REPORT**

ALL IN VOL VED	A	1	1	4	1	55	F	-	-	-			BYRNE, ROSEMARIE L																		
	B																														
	C																														
	D																														
	E																														
	F																														
	<table border="1"> <tr> <td>Officer's Rank and Signature</td> <td>DET</td> <td></td> <td>Badge/ID No.</td> <td>NCIC No.</td> <td>Precinct/Post Troop/Zone</td> <td>Station/Beat Sector</td> <td>Reviewing Officer</td> <td>Date/Time Reviewed</td> </tr> <tr> <td>Print Name in Full</td> <td colspan="2">C LOERTSCHER</td> <td>5</td> <td>05941</td> <td></td> <td></td> <td>FARRELL, S</td> <td>3/5/2024 11:59</td> </tr> </table>														Officer's Rank and Signature	DET		Badge/ID No.	NCIC No.	Precinct/Post Troop/Zone	Station/Beat Sector	Reviewing Officer	Date/Time Reviewed	Print Name in Full	C LOERTSCHER		5	05941			FARRELL, S
Officer's Rank and Signature	DET		Badge/ID No.	NCIC No.	Precinct/Post Troop/Zone	Station/Beat Sector	Reviewing Officer	Date/Time Reviewed																							
Print Name in Full	C LOERTSCHER		5	05941			FARRELL, S	3/5/2024 11:59																							

Local Codes

0544100

4W0CR2HRWR25

POLICE ACCIDENT REPORT

MV-104A (6/04)

☐ AMENDED REPORT

Accident Date			Day of Week	Military Time	No. of Vehicles	No. Injured	No. Killed	Not Investigated at Scene	☐	Left Scene	Police Photos
Month	Day	Year						Accident Reconstructed	☐	☐	☐ Yes ☒ No
3	1	2024	FRIDAY	01:10	1	0	0				

Albany Post Road



3201 Albany Post Road



Not to scale

POLICE ACCIDENT REPORT

MV-104A (6/04)

Local Codes

24-91404

MB01JFT135

AMENDED REPORT

1	Accident Date Month 9 Day 3 Year 2024 Day of Week TUESDAY Military Time 16:15 No. of Vehicles 2 No. Injured 0 No. Killed 0 Not Investigated at Scene ☐ Left Scene ☐ Police Photos ☐ Accident Reconstructed ☐ Yes ☒ No ☐	20
2	VEHICLE 1 License ID Number Y9084310 State of Lic. CA Driver Name - exactly as printed on license MORAR, ROMAN Address (Include Number and Street) 2075 W EL CAMINO AVE 820 Apt. No. City or Town SACRAMENTO State CA Zip Code 958330000 Date of Birth Month 7 Day 17 Year 1996 Sex M Unlicensed ☐ No. of Occupants 01 Public Property Damaged ☐ Name - exactly as printed on registration COAST TO COAST EXPRESS, Sex C Date of Birth Month Day Year Address (Include Number and Street) 3520 SUNRISE PINE DRIVE Apt. No. Haz. Mat. Code - Released ☐ City or Town SACRAMENTO State CA Zip Code 95827 Plate Number ZP32057 State of Reg. CA Vehicle Year & Make 2019 VOLV Vehicle Type DLR Ins. Code 989 Ticket/Arrest Number(s) Violation Section(s) 1	21
3	VEHICLE 2 License ID Number State of Lic. Driver Name - exactly as printed on license Address (Include Number and Street) Apt. No. City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed ☐ No. of Occupants 00 Public Property Damaged ☐ Name - exactly as printed on registration Sex Date of Birth Month Day Year Address (Include Number and Street) Apt. No. Haz. Mat. Code - Released ☐ City or Town State Zip Code Plate Number UNKNOWN State of Reg. 2024 DODG Vehicle Year & Make PICK Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s) 1	22
4	Check if involved vehicle is: V ☐ more than 95 inches wide; E ☐ more than 34 feet long; H ☒ operated with an overweight permit; I ☐ operated with an overdimension permit. C VEHICLE 1 DAMAGE CODES L Box 1 - Point of Impact 15 19 E Box 2 - Most Damage 13 13 Enter up to three more damage codes 13 11 5 Vehicle By: Towed To: VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER	23
5	Check if involved vehicle is: V ☐ more than 95 inches wide; E ☐ more than 34 feet long; H ☐ operated with an overweight permit; I ☐ operated with an overdimension permit. C VEHICLE 2 DAMAGE CODES L Box 1 - Point of Impact 13 13 E Box 2 - Most Damage 13 11 5 Enter up to three more damage codes 13 11 5 Vehicle By: Towed To: VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER	24
6	Circle the diagram below that describes the accident, or draw your own diagram in space #9. Number the vehicles. Rear End Left Turn Right Angle Right Turn Head On 1. 2. 3. 4. 5. 6. 7. 8. 9. ACCIDENT DIAGRAM See the last page of the MV-104A for the accident diagram. Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☒ Yes ☐ No	25
7	Reference Marker 9 A Coordinates (if available) Latitude/Northing 8 7 0 3 Longitude/Easting 2 2 4 9 Place Where Accident Occurred: County WESTCHESTER ☐ City ☒ Village ☐ Town of BUCHANAN Road on which accident occurred ALBANY POST RD (Route Number or Street Name) at 1) intersecting street or 2) .1 ☒ N ☐ S of BLEAKLEY AVE (Route Number or Street Name) feet miles ☐ E ☐ W (Milepost, Nearest intersecting Route Number or Street Name)	26
8	Accident Description/Officer's notes Driver of vehicle 1 states he was operating the tractor trailer in the right lane of the southbound lane on Albany Post Rd, SR-9A, when he approached the Metro North Iron Bridge that goes across SR-9A in an east/west direction. Driver of vehicle 1 states that he measured the truck (vehicle 2) on top of the trailer to be 13'7" to the top of the truck from the ground. Driver of vehicle 1 states he continued southbound to go underneath the bridge	27
9	ALL INVOLVED A 1 1 4 1 28 M - - - MORAR, ROMAN B 2 1 0 1 - - - C D E F Officer's Rank and Signature PO Eric R. Romeo Print Name in Full ERIC R. ROMEO Badge/ID No. 05 NCIC No. 05941 Precinct/Post Troop/Zone Station/Beat Sector Reviewing Officer TIERNAN, J Date/Time Reviewed 9/5/2024 08:23	28

New York State Department of Motor Vehicles
POLICE ACCIDENT REPORT
MV-104A (6/04)Local Codes
24-91404
MB01JFT135☐ AMENDED REPORT

1	Accident Date Month 9 Day 3 Year 2024		Day of Week TUESDAY	Military Time 16:15	No. of Vehicles 2	No. Injured 0	No. Killed 0	Not Investigated at Scene ☐	Left Scene ☐	Police Photos ☐ Yes ☒ No	20			
2	VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code					☐ VEHICLE ☐ BICYCLIST ☐ PEDESTRIAN ☐ OTHER PEDESTRIAN						21		
3	Date of Birth Month Day Year Sex Unlicensed No. of Occupants Public Property Damaged					Date of Birth Month Day Year Sex Unlicensed No. of Occupants Public Property Damaged						22		
4	Name - exactly as printed on registration Sex Date of Birth Month Day Year					Name - exactly as printed on registration Sex Date of Birth Month Day Year						23		
5	Address (Include Number and Street) Apt. No. Haz. Mat. Code Released					Address (Include Number and Street) Apt. No. Haz. Mat. Code Released						24		
6	City or Town State Zip Code					City or Town State Zip Code						25		
7	Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code					Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code						26		
8	Ticket/Arrest Number(s)					Ticket/Arrest Number(s)						27		
9	Violation Section(s)					Violation Section(s)						28		
10	Check if involved vehicle is: V ☐ more than 95 inches wide; H ☐ more than 34 feet long; I ☐ operated with an overweight permit; C ☐ operated with an overdimension permit.					Check if involved vehicle is: V ☐ more than 95 inches wide; H ☐ more than 34 feet long; I ☐ operated with an overweight permit; C ☐ operated with an overdimension permit.					Circle the diagram below that describes the accident, or draw your own diagram in space #9. Number the vehicles.		29	
11	VEHICLE DAMAGE CODES Box 1 - Point of Impact Box 2 - Most Damage Enter up to three more damage codes Vehicle By: Towed To:					VEHICLE DAMAGE CODES Box 1 - Point of Impact Box 2 - Most Damage Enter up to three more damage codes Vehicle By: Towed To:					ACCIDENT DIAGRAM		30	
12	VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER					VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER					9. Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☐ Yes ☐ No		31	
13	Reference Marker		Coordinates (if available) Latitude/Northing		Place Where Accident Occurred: County WESTCHESTER ☐ City ☐ Village ☐ Town of Road on which accident occurred at 1) intersecting street (Route Number or Street Name) or 2) (Route Number or Street Name) feet miles ☐ N ☐ S ☐ E ☐ W of (Milepost, Nearest intersecting Route Number or Street Name)							32		
14	Accident Description/Officer's notes and the top of vehicle 2 hit the bottom of the bridge causing severe damage to the top of vehicle 2. Driver of vehicle 1 then stopped the semi-truck after passing through the bridge. There were no signs posted in the area in regard to the height of the bridge. Driver of vehicle 1 used a measuring stick and stated that the heights of the bridge he had were 13'9.5" in the right lane of the north side of the bridge and 15'9" in the right lane on											33		
15	ALL INVOLVED											34		
16	Officer's Rank and Signature PO		Badge/ID No.		NCIC No.		Precinct/Post Troop/Zone		Station/Beat Sector		Reviewing Officer TIERNAN, J		Date/Time Reviewed 9/5/2024 08:23	
17	Print Name in Full ERIC R ROMEO		05		05941									

POLICE ACCIDENT REPORT

MV-104A (6/04)

Local Codes
24-91404
MB01JFT135

☐ AMENDED REPORT

1	Accident Date Month: 9, Day: 3, Year: 2024 Day of Week: TUESDAY Military Time: 16:15 No. of Vehicles: 2 No. Injured: 0 No. Killed: 0 Not Investigated at Scene: ☐ Accident Reconstructed: ☐ Left Scene: ☐ Police Photos: ☒ Yes ☐ No	19
2	VEHICLE - Driver License ID Number: _____ State of Lic.: _____ Driver Name - exactly as printed on license: _____ Address (Include Number and Street): _____ Apt. No.: _____ City or Town: _____ State: _____ Zip Code: _____ Date of Birth: _____ Sex: _____ Unlicensed: ☐ No. of Occupants: _____ Public Property Damaged: ☐ Name - exactly as printed on registration: _____ Sex: _____ Date of Birth: _____ Address (Include Number and Street): _____ Apt. No.: _____ Haz. Mat. Code: _____ Released: ☐ City or Town: _____ State: _____ Zip Code: _____ Plate Number: _____ State of Reg.: _____ Vehicle Year & Make: _____ Vehicle Type: _____ Ins. Code: _____ Ticket/Arrest Number(s): _____ Violation Section(s): _____	20
3	VEHICLE - Driver License ID Number: _____ State of Lic.: _____ Driver Name - exactly as printed on license: _____ Address (Include Number and Street): _____ Apt. No.: _____ City or Town: _____ State: _____ Zip Code: _____ Date of Birth: _____ Sex: _____ Unlicensed: ☐ No. of Occupants: _____ Public Property Damaged: ☐ Name - exactly as printed on registration: _____ Sex: _____ Date of Birth: _____ Address (Include Number and Street): _____ Apt. No.: _____ Haz. Mat. Code: _____ Released: ☐ City or Town: _____ State: _____ Zip Code: _____ Plate Number: _____ State of Reg.: _____ Vehicle Year & Make: _____ Vehicle Type: _____ Ins. Code: _____ Ticket/Arrest Number(s): _____ Violation Section(s): _____	21
4	VEHICLE - Driver License ID Number: _____ State of Lic.: _____ Driver Name - exactly as printed on license: _____ Address (Include Number and Street): _____ Apt. No.: _____ City or Town: _____ State: _____ Zip Code: _____ Date of Birth: _____ Sex: _____ Unlicensed: ☐ No. of Occupants: _____ Public Property Damaged: ☐ Name - exactly as printed on registration: _____ Sex: _____ Date of Birth: _____ Address (Include Number and Street): _____ Apt. No.: _____ Haz. Mat. Code: _____ Released: ☐ City or Town: _____ State: _____ Zip Code: _____ Plate Number: _____ State of Reg.: _____ Vehicle Year & Make: _____ Vehicle Type: _____ Ins. Code: _____ Ticket/Arrest Number(s): _____ Violation Section(s): _____	22
5	VEHICLE - Driver License ID Number: _____ State of Lic.: _____ Driver Name - exactly as printed on license: _____ Address (Include Number and Street): _____ Apt. No.: _____ City or Town: _____ State: _____ Zip Code: _____ Date of Birth: _____ Sex: _____ Unlicensed: ☐ No. of Occupants: _____ Public Property Damaged: ☐ Name - exactly as printed on registration: _____ Sex: _____ Date of Birth: _____ Address (Include Number and Street): _____ Apt. No.: _____ Haz. Mat. Code: _____ Released: ☐ City or Town: _____ State: _____ Zip Code: _____ Plate Number: _____ State of Reg.: _____ Vehicle Year & Make: _____ Vehicle Type: _____ Ins. Code: _____ Ticket/Arrest Number(s): _____ Violation Section(s): _____	23
6	VEHICLE - Driver License ID Number: _____ State of Lic.: _____ Driver Name - exactly as printed on license: _____ Address (Include Number and Street): _____ Apt. No.: _____ City or Town: _____ State: _____ Zip Code: _____ Date of Birth: _____ Sex: _____ Unlicensed: ☐ No. of Occupants: _____ Public Property Damaged: ☐ Name - exactly as printed on registration: _____ Sex: _____ Date of Birth: _____ Address (Include Number and Street): _____ Apt. No.: _____ Haz. Mat. Code: _____ Released: ☐ City or Town: _____ State: _____ Zip Code: _____ Plate Number: _____ State of Reg.: _____ Vehicle Year & Make: _____ Vehicle Type: _____ Ins. Code: _____ Ticket/Arrest Number(s): _____ Violation Section(s): _____	24
7	VEHICLE - Driver License ID Number: _____ State of Lic.: _____ Driver Name - exactly as printed on license: _____ Address (Include Number and Street): _____ Apt. No.: _____ City or Town: _____ State: _____ Zip Code: _____ Date of Birth: _____ Sex: _____ Unlicensed: ☐ No. of Occupants: _____ Public Property Damaged: ☐ Name - exactly as printed on registration: _____ Sex: _____ Date of Birth: _____ Address (Include Number and Street): _____ Apt. No.: _____ Haz. Mat. Code: _____ Released: ☐ City or Town: _____ State: _____ Zip Code: _____ Plate Number: _____ State of Reg.: _____ Vehicle Year & Make: _____ Vehicle Type: _____ Ins. Code: _____ Ticket/Arrest Number(s): _____ Violation Section(s): _____	25
8	Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit. VEHICLE DAMAGE CODES: Box 1 - Point of Impact: _____ Box 2 - Most Damage: _____ Enter up to three more damage codes: _____ Vehicle By: _____ Towed To: _____ VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER 9. ACCIDENT DIAGRAM Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☐ Yes ☐ No	26
9	Reference Marker: _____ Coordinates (if available): _____ Latitude/Northing: _____ Longitude/Easting: _____ Place Where Accident Occurred: County: WESTCHESTER ☐ City ☐ Village ☐ Town of _____ Road on which accident occurred: _____ (Route Number or Street Name) at 1) intersecting street _____ (Route Number or Street Name) or 2) _____ feet _____ miles ☐ N ☐ S ☐ E ☐ W of _____ (Milepost, Nearest intersecting Route Number or Street Name)	27
10	Accident Description/Officer's notes: the south side of the bridge. Since vehicle 2 was still on the trailer it was left on the trailer. The vehicle was being delivered to the Village of Buchanan but since the damage occurred prior to arrival a village administrator no longer wished to take the vehicle and the vehicle remained in possession of the truck company. Unknown owner and insurance information for vehicle 2 as it is also not yet registered. Vehicle 1: Out of State	28
11	8 9 10 11 12 13 14 15 16 17 BY	29
12	ALL INVOLVED	30

Officer's Rank and Signature: PO <i>Eric R. Romeo</i>	Badge/ID No.: 05	NCIC No.: 05941	Precinct/Post Troop/Zone:	Station/Beat Sector:	Reviewing Officer: TIERNAN, J	Date/Time Reviewed: 9/5/2024 08:23
Print Name in Full: ERIC R. ROMEO						

POLICE ACCIDENT REPORT

MV-104A (6/04)

AMENDED REPORT

MBU15FT135 AMENDED REPORT																									
1		Accident Date		Month 9		Day 3		Year 2024		Day of Week TUESDAY		Military Time 16:15		No. of Vehicles 2		No. Injured 0		No. Killed 0		Not Investigated at Scene ☐		Left Scene ☐		Police Photos ☐ Yes ☒ No	
VEHICLE 2 VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed ☐ No. of Occupants Public Property Damaged ☐ Name - exactly as printed on registration Sex Date of Birth Month Day Year Address (Include Number and Street) City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s) 3 VEHICLE 2 VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed ☐ No. of Occupants Public Property Damaged ☐ Name - exactly as printed on registration Sex Date of Birth Month Day Year Address (Include Number and Street) City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									
VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER																									

		8	9	10	11	12	13	14	15	16	17 BY						
ALL INVOLVED	A																
	B																
	C																
	D																
	E																
	F																
Officer's Rank and Signature		PO				Badge/ID No.		NCIC No.		Precinct/Post Troop/Zone		Station/Beat Sector		Reviewing Officer		Date/Time Reviewed	
Print Name in Full		ERIC R ROMEO				05		05941						TIERNAN, J		9/5/2024 08:23	


Local Codes
24-91404
MB01JFT135

POLICE ACCIDENT REPORT

MV-104A (6/04)

☐ AMENDED REPORT

Accident Date			Day of Week	Military Time	No. of Vehicles	No. Injured	No. Killed	Not Investigated at Scene	☐ Left Scene	Police Photos
Month	Day	Year						Accident Reconstructed	☐	☐ Yes ☒ No
9	3	2024	TUESDAY	16:15	2	0	0			

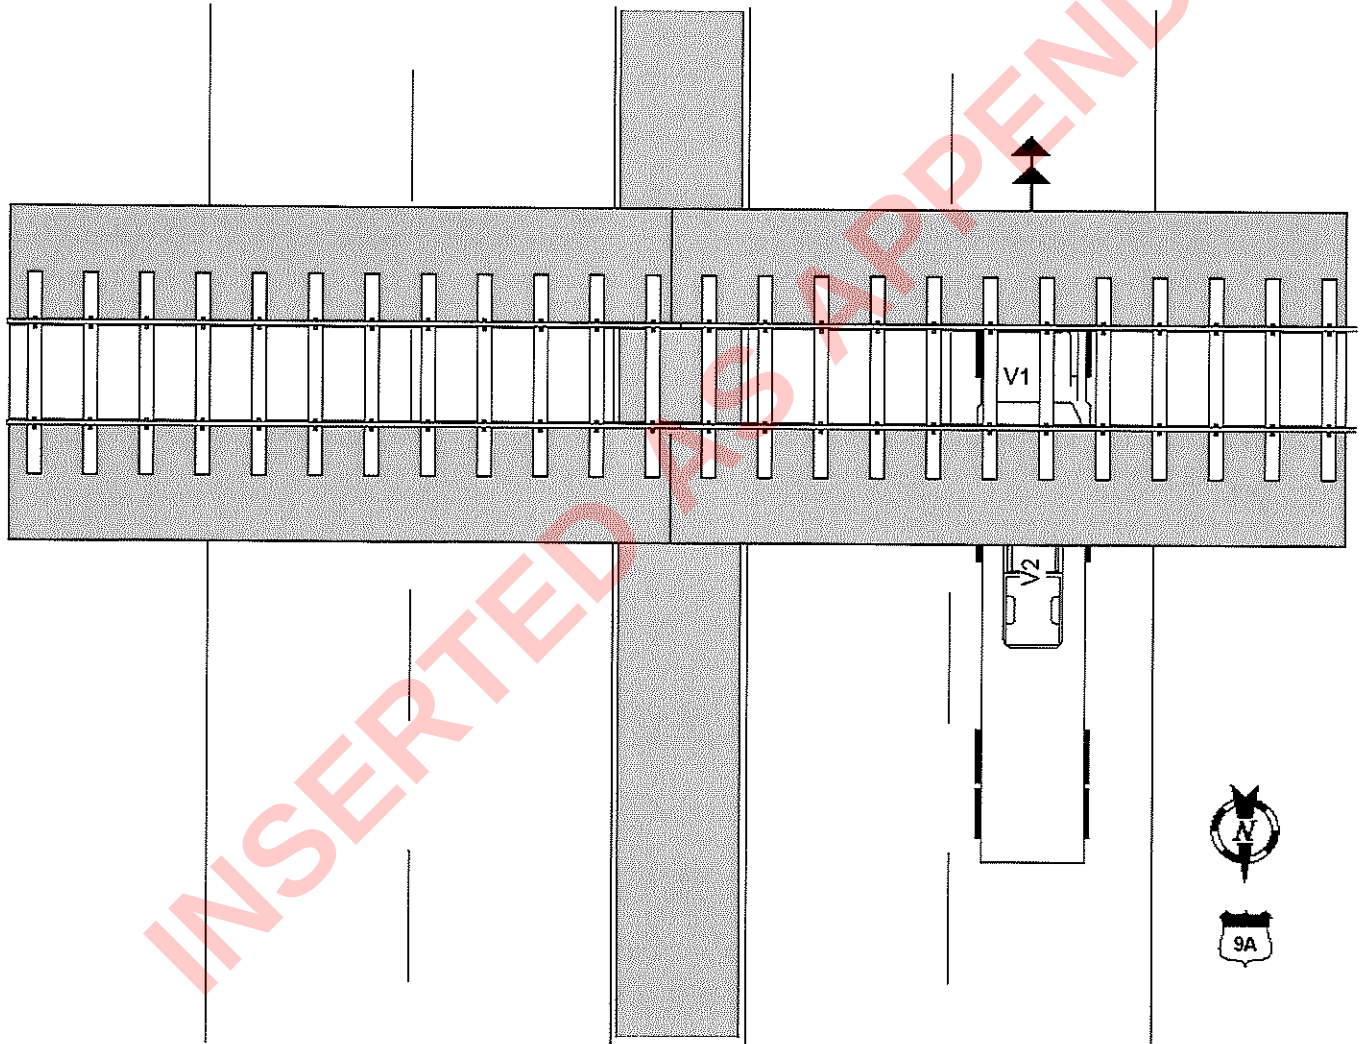

POLICE ACCIDENT REPORT

MV-104A (6/04)

Local Codes

24-91405

MB01JFT3Z1

☐ AMENDED REPORT

1	Accident Date Month 9 Day 3 Year 2024		Day of Week TUESDAY	Military Time 17:20	No. of Vehicles 2	No. Injured 0	No. Killed 0	Not Investigated at Scene ☐	Left Scene ☐	Police Photos ☐ Yes ☒ No	19 9												
2	VEHICLE 1					☒ VEHICLE 2 ☐ BICYCLIST ☐ PEDESTRIAN ☐ OTHER PEDESTRIAN						20 -											
2	VEHICLE 1- Driver License ID Number 581291382 Driver Name - exactly as printed on license BELLIVEAU, ROGER G Address (Include Number and Street) PO BOX 490					State of Lic. NY Apt. No. City or Town VERPLANK State NY Zip Code 105960000 Date of Birth Month 11 Day 13 Year 1961 Sex M Unlicensed ☐ No. of Occupants 01 Public Property Damaged ☐					VEHICLE 2- Driver License ID Number 817749265 Driver Name - exactly as printed on license ANAKWA, GODWIN E Address (Include Number and Street) 31 FRANKLINDALE 1		State of Lic. NY Apt. No. City or Town WAPPINGERS FL State NY Zip Code 125900000 Date of Birth Month 6 Day 8 Year 1971 Sex M Unlicensed ☐ No. of Occupants 01 Public Property Damaged ☐		21 -								
3	Name - exactly as printed on registration BELLIVEAU, ROGER G					Sex M Date of Birth Month 11 Day 13 Year 1961					Name - exactly as printed on registration ANAKWA, GODWIN E					Sex M Date of Birth Month 6 Day 8 Year 1971					22 -		
4	Address (Include Number and Street) PO BOX 11					Apt. No. Haz. Mat. Code - Released ☐					Address (Include Number and Street) 31 FRANKLINDALE 1					Apt. No. Haz. Mat. Code - Released ☐					23 5		
5	City or Town MONTROSE					State NY Zip Code 10548					City or Town WAPPINGERS FL					State NY Zip Code 12590					24 5		
2	Plate Number KWH3698		State of Reg. NY		Vehicle Year & Make 2013 CHEV		Vehicle Type SUBN		Ins. Code 328		Plate Number JKW1687		State of Reg. NY		Vehicle Year & Make 2008 TOYT		Vehicle Type 4DSD		Ins. Code 328		25 6		
6	Ticket/Arrest Number(s)					Violation Section(s)					Ticket/Arrest Number(s)					Violation Section(s)					26 8		
7	Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit.					Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit.					Circle the diagram below that describes the accident, or draw your own diagram in space #9. Number the vehicles.					See the last page of the MV-104A for the accident diagram.					27 1		
1	VEHICLE 1 DAMAGE CODES Box 1 - Point of Impact Box 2 - Most Damage Enter up to three more damage codes					VEHICLE 2 DAMAGE CODES Box 1 - Point of Impact Box 2 - Most Damage Enter up to three more damage codes					ACCIDENT DIAGRAM 9. Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☐ Yes ☒ No										28 1		
1	Vehicle By: Towed To:					Vehicle By: Towed To:															29 -		
1	VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER					Place Where Accident Occurred: County WESTCHESTER ☐ City ☒ Village ☐ Town of BUCHANAN Road on which accident occurred ALBANY POST RD (Route Number or Street Name) at 1) intersecting street or 2) 25 feet miles ☒ N ☐ S of BLEAKLEY AVE (Route Number or Street Name) ☐ E ☐ W (Milepost, Nearest Intersecting Route Number or Street Name)															30 -		
Accident Description/Officer's notes Driver of vehicle 1 states that he was driving south on Albany Post Rd, SR-9A, approaching the light at the intersection of Bleakley Ave. Driver of vehicle 1 states that he did not notice the traffic stopped at a red light and struck vehicle 2. Driver of vehicle 2 states he was stopped at the red light on Albany Post Rd, SR-9A, facing southbound when he was struck by vehicle 1. Vehicle 1 had minor damage to the front bumper. Vehicle 2 had damage																	30 -						
ALL INVOLVED																						30 -	
Officer's Rank and Signature PO <i>Eric R. Romeo</i>												Badge/ID No. 05		NCIC No. 05941		Precinct/Post Troop/Zone		Station/Beat Sector		Reviewing Officer TIERNAN, J		Date/Time Reviewed 9/5/2024 08:25	
Print Name in Full ERIC R ROMEO																							

POLICE ACCIDENT REPORT

MV-104A (6/04)

Local Codes

24-91405

MB01JFT3Z1

☐ AMENDED REPORT

1	Accident Date Month 9 Day 3 Year 2024 Day of Week TUESDAY Military Time 17:20 No. of Vehicles 2 No. Injured 0 No. Killed 0 Not Investigated at Scene ☐ Left Scene ☐ Police Photos ☐ Yes ☒ No Accident Reconstructed ☐	20
2	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed ☐ No. of Occupants Public Property Damaged ☐ Name - exactly as printed on registration Sex Date of Birth Month Day Year Address (Include Number and Street) Apt. No. Haz. Mat. Code Released ☐ City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	21
3	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed ☐ No. of Occupants Public Property Damaged ☐ Name - exactly as printed on registration Sex Date of Birth Month Day Year Address (Include Number and Street) Apt. No. Haz. Mat. Code Released ☐ City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	22
4	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed ☐ No. of Occupants Public Property Damaged ☐ Name - exactly as printed on registration Sex Date of Birth Month Day Year Address (Include Number and Street) Apt. No. Haz. Mat. Code Released ☐ City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	23
5	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed ☐ No. of Occupants Public Property Damaged ☐ Name - exactly as printed on registration Sex Date of Birth Month Day Year Address (Include Number and Street) Apt. No. Haz. Mat. Code Released ☐ City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	24
6	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed ☐ No. of Occupants Public Property Damaged ☐ Name - exactly as printed on registration Sex Date of Birth Month Day Year Address (Include Number and Street) Apt. No. Haz. Mat. Code Released ☐ City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	25
7	Check if involved vehicle is: V ☐ more than 95 inches wide; E ☐ more than 34 feet long; H ☐ operated with an overweight permit; I ☐ operated with an overdimension permit. C VEHICLE DAMAGE CODES Box 1 - Point of Impact 1 2 Box 2 - Most Damage 3 4 5 Enter up to three more damage codes Vehicle By: Towed To: VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER Circle the diagram below that describes the accident, or draw your own diagram in space #9. Number the vehicles. Rear End 1. 2. 3. 4. 5. 6. 7. 8. 9. Left Turn Left Turn Right Angle Right Turn Head On Sideswipe (same direction) Sideswipe (opposite direction) ACCIDENT DIAGRAM 9. Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☐ Yes ☐ No	26
8	Reference Marker Coordinates (if available) Latitude/Northing Longitude/Easting Place Where Accident Occurred: County WESTCHESTER ☐ City ☐ Village ☐ Town of Road on which accident occurred (Route Number or Street Name) at 1) intersecting street or 2) feet miles ☐ N ☐ S ☐ E ☐ W of (Route Number or Street Name) (Milepost, Nearest intersecting Route Number or Street Name)	27
9	Accident Description/Officer's notes to the rear bumper which also caused minor damage to both rear quarter panels from the bumper being pushed in. During the time of this accident, there was another accident in the same location that could have caused a distraction.	28
10	8 9 10 11 12 13 14 15 16 17 BY	29
11	ALL INVOLVED	30

8	9	10	11	12	13	14	15	16	17 BY	
A										
B										
C										
D										
E										
F										
Officer's Rank and Signature	PO	ERIC R ROMEO	Badge/ID No.	05	NCIC No.	05941	Precinct/Post Troop/Zone	Station/Beat Sector	Reviewing Officer	Date/Time Reviewed
Print Name in Full	ERIC R ROMEO								TIERNAN, J	9/5/2024 08:25

Local Codes
24-91405
MB01JFT3Z1

POLICE ACCIDENT REPORT

MV-104A (6/04)

☐ AMENDED REPORT

Accident Date			Day of Week	Military Time	No. of Vehicles	No. Injured	No. Killed	Not Investigated at Scene	☐ Left Scene	Police Photos
Month	Day	Year						Accident Reconstructed	☐	☐ Yes ☒ No
9	3	2024	TUESDAY	17:20	2	0	0			



Bleakley Ave




INSERTED AS APPENDIX

POLICE ACCIDENT REPORT

MV-104A (6/04)

Local Codes
25-030328
4WC267K3FN17

☐ AMENDED REPORT

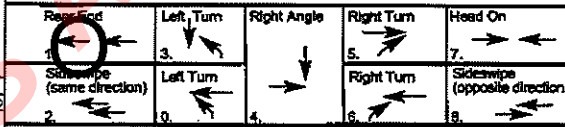1	Accident Date Month 3 Day 6 Year 2025	Day of Week THURSDAY	Military Time 15:21	No. of Vehicles 2	No. Injured 0	No. Killed 0	Not Investigated at Scene ☐	Left Scene ☐	Police Photos ☐ Yes ☒ No	19	
2	VEHICLE 1				☒ VEHICLE 2 ☐ BICYCLIST ☐ PEDESTRIAN ☐ OTHER PEDESTRIAN						20
2	VEHICLE 1- Driver License ID Number 923068256 Driver Name - exactly as printed on license ZHININ-JOYASACA, BLANCA L Address (Include Number and Street) 9 VICTORIA AVE City or Town MONTROSE State NY Zip Code 105480000 Date of Birth Month 7 Day 28 Year 1994 Sex F Unlicensed ☐ No. of Occupants 01 Public Property Damaged ☐ Name - exactly as printed on registration ZHININ-JOYASACA, B L Sex F Date of Birth Month 7 Day 28 Year 1994 Address (Include Number and Street) PO BOX 889 Apt. No. Haz. Mat. Code Released ☐ City or Town VERPLANCK State NY Zip Code 10596 Plate Number HPP1278 State of Reg. NY Vehicle Year & Make 2014 TOYT Vehicle Type SUBN Ins. Code 328 Ticket/Arrest Number(s)				VEHICLE 2- Driver License ID Number 375986233 Driver Name - exactly as printed on license BRUMLEVE, DEREK JOHN Address (Include Number and Street) 12 EMERSON PL City or Town MONTROSE State NY Zip Code 105480000 Date of Birth Month 7 Day 30 Year 1987 Sex M Unlicensed ☐ No. of Occupants 01 Public Property Damaged ☐ Name - exactly as printed on registration BRUMLEVE, DEREK J Sex M Date of Birth Month 7 Day 30 Year 1987 Address (Include Number and Street) 12 EMERSON PL Apt. No. Haz. Mat. Code Released ☐ City or Town MONTROSE State NY Zip Code 10548 Plate Number LRG7590 State of Reg. NY Vehicle Year & Make 2015 SUBA Vehicle Type SUBN Ins. Code 639 Ticket/Arrest Number(s)				21		
3	Violation Section(s) 1				Violation Section(s) 8						22
4	Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit.				Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit.						23
5	VEHICLE 1 DAMAGE CODES L Box 1 - Point of Impact 8 1 2 E Box 2 - Most Damage 3 4 5 Enter up to three more damage codes				VEHICLE 2 DAMAGE CODES L Box 1 - Point of Impact 2 1 2 E Box 2 - Most Damage 1 3 4 5 Enter up to three more damage codes						24
6	Vehicle By: Towed To: VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER				Circle the diagram below that describes the accident, or draw your own diagram in space #9. Number the vehicles.  9. Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☒ Yes ☐ No						25
7	Reference Marker Coordinates (if available) Latitude/Northing Longitude/Easting				Place Where Accident Occurred: County WESTCHESTER ☐ City ☒ Village ☐ Town of BUCHANAN Road on which accident occurred ALBANY POST RD (Route Number or Street Name) at 1) intersecting street or 2) 200 feet miles ☒ N ☐ S of BLEAKLEY AVE (Route Number or Street Name) ☐ E ☐ W (Milepost, Nearest intersecting Route Number or Street Name)						26
8	Accident Description/Officer's notes Driver 1 Stopped at a complete stop for school bus crossing. Driver 2 was following to closely and could not stop in time. Driver 2 rear ended driver 1.										27

ALL INVOLVED	8	9	10	11	12	13	14	15	16	17 BY	
A	1	1	4	1	30	F	-	-	-		ZHININ-JOYASACA, BL
B	2	1	4	1	37	M	-	-	-		BRUMLEVE, DEREK JOH
C											
D											
E											
F											
Officer's Rank and Signature	PO					Badge/ID No.	NCIC No.	Precinct/Post Troop/Zone	Station/Beat Sector	Reviewing Officer	Date/Time Reviewed
Print Name in Full	R. BUDDE					7	05941			TIERNAN, J	3/10/2025 10:14

POLICE ACCIDENT REPORT

MV-104A (6/04)

Local Codes
IN-25-071129
4WMB02KM33R3☐ AMENDED REPORT

1	Accident Date Month 7 Day 31 Year 2025 Day of Week THURSDAY Military Time 08:09 No. of Vehicles 2 No. Injured 1 No. Killed 0 Not Investigated at Scene ☐ Left Scene ☐ Police Photos ☒ Yes ☐ No	20
2	VEHICLE 1 Driver License ID Number 659546128 Driver Name - exactly as printed on license RAMONDINO, CHRISTINA LEAH Address (Include Number and Street) 231 SPROUT BROOK RD City or Town CORTLANDT MANOR State NY Zip Code 105670000 Date of Birth 8/11/1983 Sex F Unlicensed ☐ No. of Occupants 04 Public Property Damaged ☐ Name - exactly as printed on registration RAMONDINO, PETER S Sex M Date of Birth 8/24/1976 Address (Include Number and Street) 231 SPROUT BROOK RD Apt. No. Haz. Mat. Code - Released ☐ City or Town CORTLANDT MANO State NY Zip Code 10567 Plate Number DCY5139 State of Reg. NY Vehicle Year & Make 2021 ACUR Vehicle Type SUBN Ins. Code 639 Ticket/Arrest Number(s)	21
3	VEHICLE 2 Driver License ID Number 273228255 Driver Name - exactly as printed on license RAMOS SALAZAR, KILDER ALEXANDER Address (Include Number and Street) 1381 HOWARD ST APT 1 City or Town PEEKSKILL State NY Zip Code 105660000 Date of Birth 11/11/1987 Sex M Unlicensed ☐ No. of Occupants 01 Public Property Damaged ☐ Name - exactly as printed on registration LLC, JW&P CONSTRUCTION Sex C Date of Birth Address (Include Number and Street) PO BOX 656 Apt. No. Haz. Mat. Code - Released ☐ City or Town KATONAH State NY Zip Code 10536 Plate Number 31012NE State of Reg. NY Vehicle Year & Make 2004 FORD Vehicle Type DUMP Ins. Code 011 Ticket/Arrest Number(s)	22
4	Violation Section(s) 1	23
5	Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit. VEHICLE 1 DAMAGE CODES Box 1 - Point of Impact 1 2 3 Box 2 - Most Damage 2 3 4 5 Enter up to three more damage codes 1 2 3 Vehicle By: Towed To: VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER	24
6	Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit. VEHICLE 2 DAMAGE CODES Box 1 - Point of Impact 10 10 Box 2 - Most Damage 10 10 Enter up to three more damage codes 10 Vehicle By: Towed To:	25
7	Circle the diagram below that describes the accident, or draw your own diagram in space #9. Number the vehicles. Rear End Left Turn Right Angle Right Turn Head On 1. 2. 3. 4. 5. 6. 7. 8. 9. ACCIDENT DIAGRAM See the last page of the MV-104A for the accident diagram. Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☒ Yes ☐ No	26
8	Reference Marker Coordinates (if available) Latitude/Northing Longitude/Easting Place Where Accident Occurred: County WESTCHESTER ☐ City ☒ Village ☐ Town of BUCHANAN Road on which accident occurred ALBANY POST ROAD (Route Number or Street Name) at 1) intersecting street or 2) 200 feet miles ☒ N ☐ S of 200 FEET NORTH OF BLEAKLEY AVENUE (Route Number or Street Name) ☐ E ☐ W (Milepost, Nearest intersecting Route Number or Street Name)	27
9	Accident Description/Officer's notes V1 was traveling in a southerly direction on Albany Post Road. V2 was allegedly traveling in a southerly direction on Albany Post Road in the "Right Hand Turn Only" lane. Operator of V1 reports V2 decided to make a "U Turn" and cut her off, causing V1 to strike V2. Operator of V2 alleges being in the lane closer to the median, going straight ahead and attempting to turn into a local mechanics shop when being struck by V1. Operator of V1 reports	28
10	8 9 10 11 12 13 14 15 16 17 BY A 1 1 4 1 41 F - - - B 1 6 4 1 F - - - C 1 5 4 1 F 04 11 6 D 1 4 5 1 M - - - E 2 1 4 1 37 M - - - F	29
11	Officer's Rank and Signature DET Print Name in Full C LOERTSCHER Badge/ID No. 5 NCIC No. 05941 Precinct/Post Troop/Zone Station/Beat Sector Reviewing Officer FARRELL, S Date/Time Reviewed 8/6/2025 14:42	30

ALL INVOLVED

Local Codes

IN-25-071129

4WMB02KM33R3

POLICE ACCIDENT REPORT

MV-104A (6/04)

☐ AMENDED REPORT

1	Accident Date Month 7 Day 31 Year 2025 Day of Week THURSDAY Military Time 08:09 No. of Vehicles 2 No. Injured 1 No. Killed 0 Not Investigated at Scene ☐ Left Scene ☐ Police Photos ☐ Yes ☒ No Accident Reconstructed ☐	20
2	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed No. of Occupants Public Property Damaged Name - exactly as printed on registration Address (Include Number and Street) City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	21
3	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed No. of Occupants Public Property Damaged Name - exactly as printed on registration Address (Include Number and Street) City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	22
4	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed No. of Occupants Public Property Damaged Name - exactly as printed on registration Address (Include Number and Street) City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	23
5	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed No. of Occupants Public Property Damaged Name - exactly as printed on registration Address (Include Number and Street) City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	24
6	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed No. of Occupants Public Property Damaged Name - exactly as printed on registration Address (Include Number and Street) City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	25
7	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed No. of Occupants Public Property Damaged Name - exactly as printed on registration Address (Include Number and Street) City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	26
8	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed No. of Occupants Public Property Damaged Name - exactly as printed on registration Address (Include Number and Street) City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	27
9	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed No. of Occupants Public Property Damaged Name - exactly as printed on registration Address (Include Number and Street) City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	28
10	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed No. of Occupants Public Property Damaged Name - exactly as printed on registration Address (Include Number and Street) City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	29
11	VEHICLE VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month Day Year Sex Unlicensed No. of Occupants Public Property Damaged Name - exactly as printed on registration Address (Include Number and Street) City or Town State Zip Code Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	30

8	9	10	11	12	13	14	15	16	17	BY
A										
B										
C										
D										
E										
F										
Officer's Rank and Signature	DET	Signature	Badge/ID No.	NCIC No.	Precinct/Post Troop/Zone	Station/Beat Sector	Reviewing Officer	Date/Time Reviewed		
Print Name in Full	C	LOERTSCHER	5	05941			FARRELL, S	8/6/2025 14:42		


Local Codes
IN-25-071129
4WMB02KM33R3

POLICE ACCIDENT REPORT

MV-104A (6/04)

☐ AMENDED REPORT

Accident Date			Day of Week	Military Time	No. of Vehicles	No. Injured	No. Killed	Not Investigated at Scene	☐	Left Scene	Police Photos
Month	Day	Year						Accident Reconstructed	☐	☐	☐ Yes ☒ No
7	31	2025	THURSDAY	08:09	2	1	0				

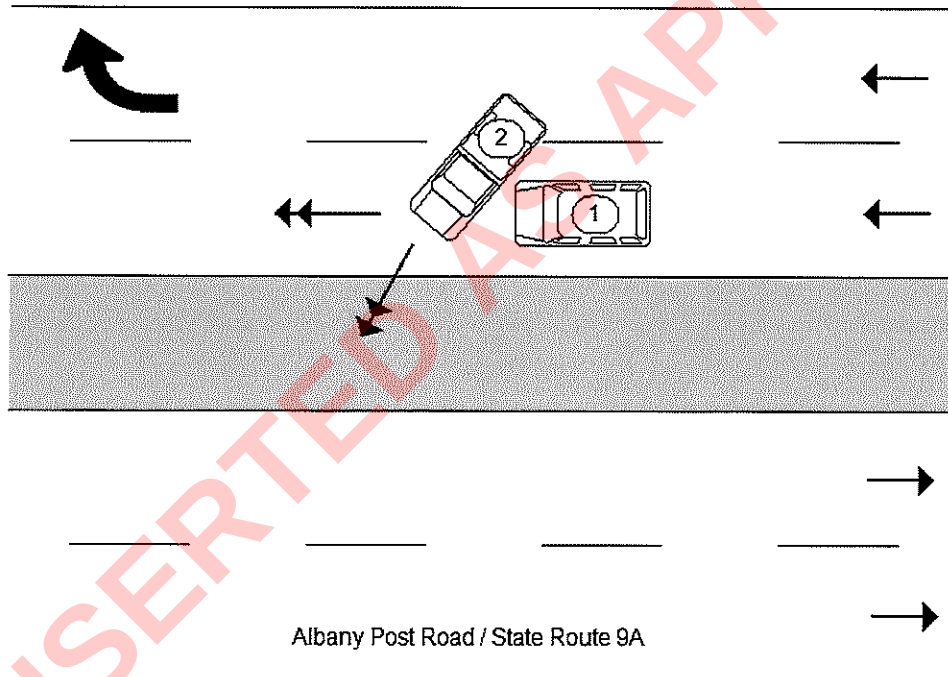

Not to Scale

POLICE ACCIDENT REPORT

MV-104A (6/04)

Local Codes
IN-25-081172
4WMB02KNLDMK

☐ AMENDED REPORT

1	Accident Date Month 8 Day 14 Year 2025 Day of Week THURSDAY Military Time 11:59 No. of Vehicles 2 No. Injured 0 No. Killed 0 Not Investigated at Scene ☐ Left Scene ☐ Police Photos ☐ Yes ☒ No	20
2	VEHICLE 1 License ID Number 778348029 Driver Name - exactly as printed on license MCGUIRE, MERANDA L Address (Include Number and Street) 14 COLLEGE HILL RD City or Town MONTROSE State NY Zip Code 105480000 Date of Birth Month 1 Day 10 Year 1974 Sex F Unlicensed ☐ No. of Occupants 02 Public Property Damaged ☐ Name - exactly as printed on registration MCGUIRE, MERANDA L Address (Include Number and Street) 14 COLLEGE HILL RD City or Town MONTROSE State NY Zip Code 10548 Plate Number KKA1327 State of Reg. NY Vehicle Year & Make 2020 HYUN Vehicle Type SUBN Ins. Code 639 Ticket/Arrest Number(s)	21
3	VEHICLE 2 License ID Number 772196230 Driver Name - exactly as printed on license CHRISTMANN, EMILY ROSE Address (Include Number and Street) 16 OLD FARM CT City or Town DEPEW State NY Zip Code 140430000 Date of Birth Month 7 Day 18 Year 2001 Sex F Unlicensed ☐ No. of Occupants 01 Public Property Damaged ☐ Name - exactly as printed on registration CHRISTMANN, EMILY R Address (Include Number and Street) 16 OLD FARM CT City or Town DEPEW State NY Zip Code 14043 Plate Number LGA7702 State of Reg. NY Vehicle Year & Make 2024 BUIC Vehicle Type SUBN Ins. Code 639 Ticket/Arrest Number(s)	22
4	Violation Section(s) 1	23
5	Check if involved vehicle is: V ☐ more than 95 inches wide; E ☐ more than 34 feet long; H ☐ operated with an overweight permit; I ☐ operated with an overdimension permit. C VEHICLE 1 DAMAGE CODES L Box 1 - Point of Impact 8 1 2 E Box 2 - Most Damage 8 Enter up to three more damage codes 3 4 5 Vehicle By: Towed To: VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER	24
6	Check if involved vehicle is: V ☐ more than 95 inches wide; E ☐ more than 34 feet long; H ☐ operated with an overweight permit; I ☐ operated with an overdimension permit. C VEHICLE 2 DAMAGE CODES L Box 1 - Point of Impact 2 1 2 E Box 2 - Most Damage 2 Enter up to three more damage codes 3 4 5 Vehicle By: Towed To: VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER	25
7	Circle the diagram below that describes the accident, or draw your own diagram in space #9. Number the vehicles. 1. Rear End 2. Left Turn 3. Right Angle 4. Right Turn 5. Head On 6. Sidewipe (same direction) 7. Left Turn 8. Right Turn 9. Sidewipe (opposite direction)	26
8	ACCIDENT DIAGRAM 9. Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☒ Yes ☐ No	27
9	Reference Marker 9 A Coordinates (if available) Latitude/Northing Longitude/Easting 8 7 0 3 Place Where Accident Occurred: County WESTCHESTER ☐ City ☒ Village ☐ Town of BUCHANAN Road on which accident occurred ALBANY POST ROAD (Route Number or Street Name) at 1) intersecting street or 2) 50 feet miles ☒ N ☐ S of BLEAKLEY AVENUE (Route Number or Street Name) ☐ E ☐ W (Milepost, Nearest intersecting Route Number or Street Name)	28
10	Accident Description/Officer's notes V1 TRAVELING SOUTHBOUND ON ALBANY POST ROAD (SR9A) STOPPED IN TRAFFIC. V2 TRAVELING SOUTHBOUND ON ALBANY POST ROAD (SR9A) DIRECTLY BEHIND V1. V2 FAILS TO STOP AND COLLIDES WITH V1 CAUSING DAMAGE TO BOTH VEHICLES. BOTH VEHICLE OPERATORS STATE SAME.	29

ALL INVOLVED	8	9	10	11	12	13	14	15	16	17 BY					
A	1	1	4	1	51	F	-	-	-		MCGUIRE, MERANDA L				
B	1	3	4	1	56	M	-	-	-		SCULLY, CRAIG S				
C	2	1	4	1	24	F	-	-	-		CHRISTMANN, EMILY R				
D															
E															
F															
Officer's Rank and Signature	PO	DAVID REGG				Badge/ID No.	2	NCIC No.	05941	Precinct/Post Troop/Zone	Station/Beat Sector	Reviewing Officer	TIERNAN, J	Date/Time Reviewed	8/14/2025 16:07

POLICE ACCIDENT REPORT

MV-104A (6/04)

Local Codes
26-10094
4WDSK1L7LC88

☐ AMENDED REPORT

1	Accident Date Month: 1, Day: 17, Year: 2026 Day of Week: SATURDAY Military Time: 13:20 No. of Vehicles: 1 No. Injured: 0 No. Killed: 0 Not Investigated at Scene: ☐ Left Scene: ☒ Police Photos: ☐ Yes ☒ No Accident Reconstructed: ☐	20
2	VEHICLE 1 VEHICLE 1 - Driver License ID Number Driver Name - exactly as printed on license: LSA, Address (Include Number and Street) City or Town State Zip Code Date of Birth Month: 7, Day: 24, Year: 1961 Sex: M Unlicensed: ☐ No. of Occupants: 01 Public Property Damaged: ☐ Name - exactly as printed on registration: UZHCA, LUIS Address (Include Number and Street): 15B CROTON ST City or Town: OSSINING State: NY Zip Code: 10562 Plate Number: LEF8284 State of Reg: NY Vehicle Year & Make: 2002 HOND Vehicle Type: 2DSD Ins. Code: 743 Ticket/Arrest Number(s) Violation Section(s)	21
3	VEHICLE 2 VEHICLE 2 - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code Date of Birth Month: , Day: , Year: Sex: Unlicensed: ☐ No. of Occupants: Public Property Damaged: ☐ Name - exactly as printed on registration Address (Include Number and Street) City or Town State Zip Code Plate Number State of Reg Vehicle Year & Make Vehicle Type Ins. Code Ticket/Arrest Number(s) Violation Section(s)	22
4	Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit. VEHICLE DAMAGE CODES Box 1 - Point of Impact Box 2 - Most Damage Enter up to three more damage codes Vehicle By: Towed To: VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER	23
5	Circle the diagram below that describes the accident, or draw your own diagram in space #9. Number the vehicles. Rear End Left Turn Right Angle Right Turn Head On Sideswipe (same direction) Left Turn Right Turn Sideswipe (opposite direction)	24
6	ACCIDENT DIAGRAM See the last page of the MV-104A for the accident diagram.	25
7	Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☐ Yes ☒ No	26
8	Reference Marker Coordinates (if available) Latitude/Northing Longitude/Easting Place Where Accident Occurred: County: WESTCHESTER Road on which accident occurred: ALBANY POST RD at 1) intersecting street or 2) 100 feet miles N S E W of BLEAKLEY AVE (Milepost, Nearest intersecting Route Number or Street Name)	27
9	Accident Description/Officer's notes Property Owner of 3211 Albany Post Rd called to report that V1 slid off the roadway, struck his fence, and then left the area. Contact was made with the registered owner of V1 who stated he was not driving the vehicle. Attempts to obtain driver information yielded negative results. Fence owner: Michael Bleakley, 914-648-8361 PROPERTY DAMAGED BY VEHICLE #01- FENCE MICHAEL P BLEAKLEY 3211 ALBANY POST RD BUCHANAN, NY 10511	28
10	8 9 10 11 12 13 14 15 16 17 BY	29
11	Officer's Rank and Signature: PO Print Name in Full: ERIC R ROMEO Badge/ID No.: 05 NCIC No.: 05941 Precinct/Post Troop/Zone Station/Beat Sector Reviewing Officer: TIERNAN, J Date/Time Reviewed: 1/20/2026 23:29	30

ALL INVOLVED

Local Codes
26-10094
4WDSK1L7LC88

POLICE ACCIDENT REPORT

MV-104A (6/04)

☐ AMENDED REPORT

Accident Date			Day of Week	Military Time	No. of Vehicles	No. Injured	No. Killed	Not Investigated at Scene	☐ Left Scene	Police Photos
Month	Day	Year						Accident Reconstructed	☐	☐ Yes ☒ No
1	17	2026	SATURDAY	13:20	1	0	0		☒	



Albany Post Rd



3211 Albany Post Rd

POLICE ACCIDENT REPORT

MV-104A (6/04)

Local Codes

IN-26-050853

4WOWS3LPGXDW

AMENDED REPORT

1	Accident Date Month 5 Day 31 Year 2026 Day of Week SUNDAY Military Time 00:13 No. of Vehicles 3 No. Injured 1 No. Killed 0 Not Investigated at Scene ☐ Left Scene ☐ Police Photos ☐ Yes ☒ No	20
2	VEHICLE 1 License ID Number 978358424 Driver Name - exactly as printed on license MACANCELA, CAROLINE E Address (Include Number and Street) 224 TATE AVENUE City or Town BUCHANAN State NY Zip Code 10511 Date of Birth Month 7 Day 8 Year 2006 Sex F Unlicensed ☐ No. of Occupants 01 Public Property Damaged ☐ Name - exactly as printed on registration MACANCELA, MANUEL M Sex M Date of Birth Month 8 Day 9 Year 1971 Address (Include Number and Street) 27 MARKET STREET 2 Apt. No. Haz. Mat. Code Released City or Town OSSINING State NY Zip Code 10562 Plate Number LCR7145 State of Reg. NY Vehicle Year & Make 2015 FORD Vehicle Type 4DSD Ins. Code 743	21
3	VEHICLE 2 License ID Number Driver Name - exactly as printed on license PARKED, Address (Include Number and Street) City or Town YORKTOWN HEIGHTS State NY Zip Code Date of Birth Month Day Year Sex Unlicensed No. of Occupants Public Property Damaged Name - exactly as printed on registration GAMBOA-VASQUEZ, J E Sex F Date of Birth Month 2 Day 22 Year 1990 Address (Include Number and Street) 41 SHENOROCK DRIVE Apt. No. Haz. Mat. Code Released City or Town YORKTOWN HEIGHTS State NY Zip Code Plate Number UNP6794 State of Reg. NY Vehicle Year & Make 2018 SUBA Vehicle Type 4DSD Ins. Code 639	22
4	Ticket/Arrest Number(s) Violation Section(s)	23
5	Check if involved vehicle is: V ☐ more than 95 inches wide; E ☐ more than 34 feet long; H ☐ operated with an overweight permit; I ☐ operated with an overdimension permit. C VEHICLE 1 DAMAGE CODES L Box 1 - Point of Impact 3 1 2 E Box 2 - Most Damage 3 3 5 1 Enter up to three more damage codes 3 2 4 Vehicle By: DON'S TOWING Towed To: DON'S TOWING VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER	24
6	Check if involved vehicle is: V ☐ more than 95 inches wide; E ☐ more than 34 feet long; H ☐ operated with an overweight permit; I ☐ operated with an overdimension permit. C VEHICLE 2 DAMAGE CODES L Box 1 - Point of Impact 9 1 9 E Box 2 - Most Damage 9 9 5 2 Enter up to three more damage codes 10 9 8 Vehicle By: RON'S SERVICE Towed To: RON'S SERVICE VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 17. DEMOLISHED 15. TRAILER 18. NO DAMAGE 16. OVERTURNED 19. OTHER	25
7	Circle the diagram below that describes the accident, or draw your own diagram in space #9. Number the vehicles. Rear End Left Turn Right Angle Right Turn Head On 1. 2. 3. 4. 5. 6. 7. 8. 9. Sideswipe (same direction) Left Turn Right Turn Sideswipe (opposite direction) 2. 3. 4. 5. 6. 7. 8. 9. ACCIDENT DIAGRAM See the last page of the MV-104A for the accident diagram. 9. Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☒ Yes ☐ No	26
8	Reference Marker Coordinates (if available) Latitude/Northing Longitude/Easting Place Where Accident Occurred: County WESTCHESTER ☐ City ☒ Village ☐ Town of BUCHANAN Road on which accident occurred LINDSEY AVENUE (Route Number or Street Name) at 1) intersecting street or 2) 150 feet miles ☐ N ☒ S of 150 FEET SOUTH OF HENRY STREET INTER (Route Number or Street Name) (Milepost, Nearest intersecting Route Number or Street Name)	27
9	Accident Description/Officer's notes V1 was traveling in a Northerly direction when operator of V1 reports that the wheels\ locked up causing her to lose control and hit V2 and then V3. V3 then hit a street sign as a result of the impact. V2 and V3 were parked and unoccupied. Operator of V1 reported head and leg pain due to accident / airbag deployment. Operator of V1 was transported to Hudson Valley Hospital by Cortlandt Ambulance. V1 was transported by Don's Towing to Don's	28
10	8 9 10 11 12 13 14 15 16 17 BY A 1 1 4 1 19 F 11 12 6 9993 5908 MACANCELA, CAROLINE B C D E F	29
11	Officer's Rank and Signature DET [Signature] Print Name in Full C LOERTSCHER Badge/ID No. 5 NCIC No. 05941 Precinct/Post Troop/Zone Station/Beat Sector Reviewing Officer FARRELL, S Date/Time Reviewed 06/12/2026 08:46	30

ALL INVOLVED

Local Codes

IN-26-050853

4W0WS3LPGXDW

POLICE ACCIDENT REPORT

MV-104A (6/04)

☐ AMENDED REPORT

1	Accident Date Month: 5, Day: 31, Year: 2026		Day of Week SUNDAY	Military Time 00:13	No. of Vehicles 3	No. Injured 1	No. Killed 0	Not Investigated at Scene ☐	Left Scene ☐	Police Photos ☐ Yes ☒ No	20	
2	VEHICLE 3					☐ VEHICLE ☐ BICYCLIST ☐ PEDESTRIAN ☐ OTHER PEDESTRIAN						21
3	VEHICLE 3- Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code					VEHICLE - Driver License ID Number Driver Name - exactly as printed on license Address (Include Number and Street) City or Town State Zip Code						22
4	Date of Birth Month: 6, Day: 10, Year: 1994 Sex: F Unlicensed: ☐ No. of Occupants: 00 Public Property Damaged: ☒					Date of Birth Month: 6, Day: 10, Year: 1994 Sex: F Unlicensed: ☐ No. of Occupants: 00 Public Property Damaged: ☐						23
5	Name - exactly as printed on registration BENEDETTO, MARISSA L Address (Include Number and Street) 171 LINDSEY AVENUE City or Town State Zip Code					Name - exactly as printed on registration Address (Include Number and Street) City or Town State Zip Code						24
6	Plate Number LTS7026 State of Reg. NY Vehicle Year & Make 2007 HOND Vehicle Type SUBN Ins. Code 100					Plate Number State of Reg. Vehicle Year & Make Vehicle Type Ins. Code						25
7	Ticket/Arrest Number(s) Violation Section(s)					Ticket/Arrest Number(s) Violation Section(s)						26
8	Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit.					Check if involved vehicle is: ☐ more than 95 inches wide; ☐ more than 34 feet long; ☐ operated with an overweight permit; ☐ operated with an overdimension permit.						27
9	VEHICLE 3 DAMAGE CODES Box 1 - Point of Impact Box 2 - Most Damage Enter up to three more damage codes Vehicle By: Towed To: VEHICLE DAMAGE CODING: 1-13 SEE DIAGRAM ON RIGHT. 14. UNDERCARRIAGE 15. TRAILER 16. OVERTURNED 17. DEMOLISHED 18. NO DAMAGE 19. OTHER					VEHICLE DAMAGE CODES Box 1 - Point of Impact Box 2 - Most Damage Enter up to three more damage codes Vehicle By: Towed To: ACCIDENT DIAGRAM 9. Cost of repairs to any one vehicle will be more than \$1000. ☐ Unknown/Unable to determine ☐ Yes ☐ No						28
10	Reference Marker Coordinates (if available) Latitude/Northing Longitude/Easting					Place Where Accident Occurred: County WESTCHESTER Road on which accident occurred at 1) intersecting street or 2) feet miles N S E W of (Milepost, Nearest intersecting Route Number or Street Name)						29
11	Accident Description/Officer's notes Towing. V2 was towed by Ron's Service to Ron's Service. V3 was not towed. No further injuries reported. PROPERTY DAMAGED BY VEHICLE #03- "ROTARY" STREET SIGN VILLAGE OF BUCHANAN 236 TATE AVENUE BUCHANAN, NY 10511											30

ALL INVOLVED	8	9	10	11	12	13	14	15	16	17 BY
A										
B										
C										
D										
E										
F										
Officer's Rank and Signature	DET		D. J. S.		Badge/ID No.	5		NCIC No.	05941	
Print Name in Full	C LOERTSCHER				Precinct/Post Troop/Zone			Station/Beat Sector		
Reviewing Officer	FARRELL, S				Date/Time Reviewed	06/12/2026 08:46				


POLICE ACCIDENT REPORT

MV-104A (6/04)

Local Codes
IN-26-050853
4W0WS3LPGXDW

☐ AMENDED REPORT

Accident Date		Day of Week	Military Time	No. of Vehicles	No. Injured	No. Killed	Not Investigated at Scene	☐ Left Scene	Police Photos
Month	Day	Year					Accident Reconstructed	☐	☐ Yes ☒ No
5	31	2026	SUNDAY	00:13	3	1	0		

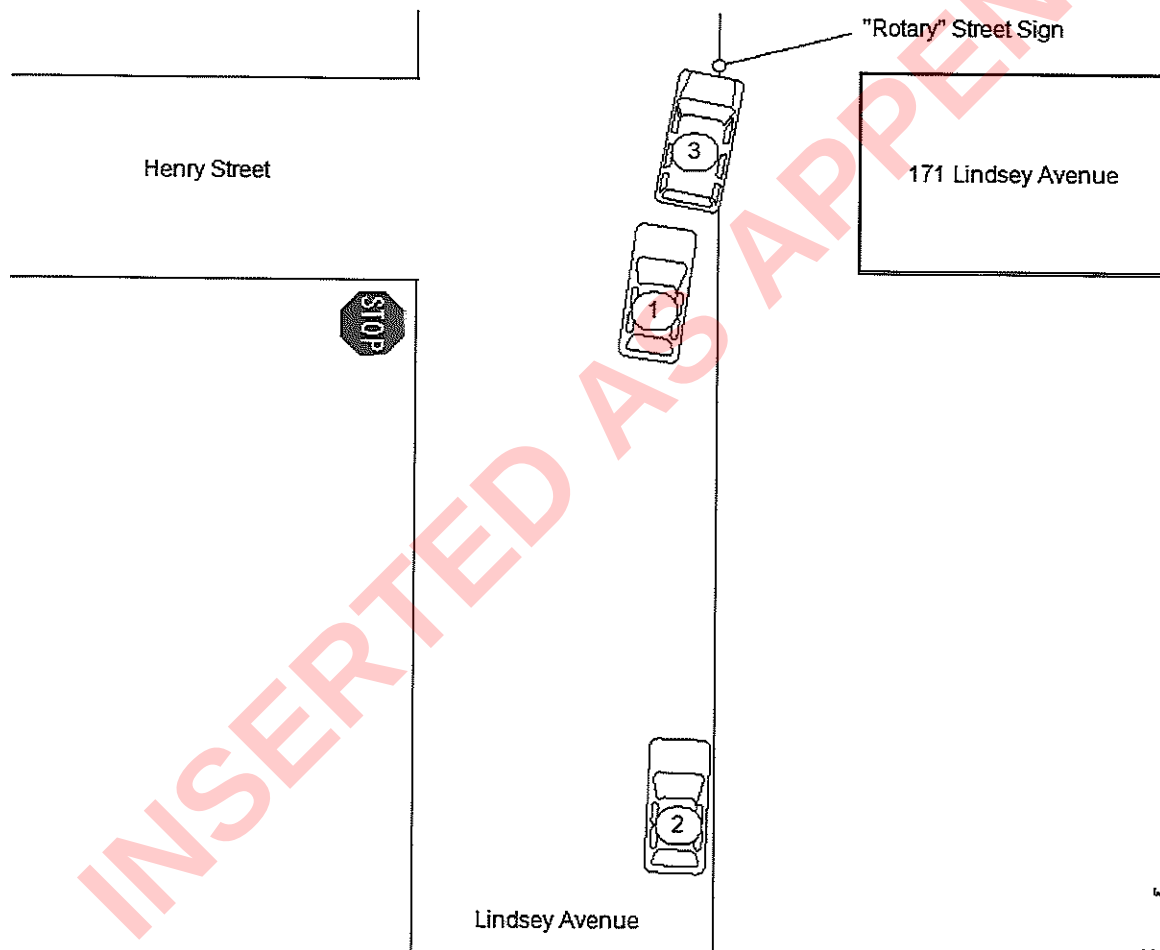

Not to scale